

Health and Safety Plan
for
Mine Fill A (SWMU 12)
Mine Fill B (SWMU 13)
**Cast High Explosives Fill/
Incinerator Complex (SWMU 16)**
Pyrotechnic Test Area (SWMU 19)

**Naval Surface Warfare Center
Crane Division
Crane, Indiana**



**Southern Division
Naval Facilities Engineering Command
CONTRACT NUMBER N62467-94-D-0888**

Contract Task Orders 0166

**October 2003
Revision 1**



TETRA TECH NUS, INC.

661 Andersen Drive • Pittsburgh, PA 15220
Tel 412.921.7090 • Fax 412.921.4040 • www.tetrattech.com

PITT-10-3-036

October 14, 2003

Project No. 3994

Mr. William Gates (ES32)
Commander, Southern Division
Naval Facilities Engineering Command
2155 Eagle Drive, P.O. Box 190010
North Charleston, SC 29419-9010

Reference: CLEAN Contract No. N62467-94-D-0888
Contract Task Order No. 0166

Subject: Revision 1 to Health and Safety Plan for Mine Fill A (SWMU 12),
Mine Fill B (SWMU 13), Cast High Explosives Fill/Incinerator
Complex (SWMU 16), and Pyrotechnic Test Area (SWMU 19)

Dear Mr. Gates:

Enclosed is one (1) copy of the subject plan. Modifications have been made to the original Health and Safety Plan to incorporate the results from the first round of sampling at SWMUs 13 and 16.

Please contact Ralph Basinski at (412) 921-8308 (e-mail basinskir@ttnus.com) regarding any questions or comments.

Sincerely,

Ralph R. Basinski
Task Order Manager

RRB/mlg
Enclosure

cc: Mr. Tom Brent, NSWC Crane (1 copy of enclosure)
Ms. Debbie Wroblewski, TtNUS, Inc. (letter only)
Mr. Mark Perry, TtNUS, Inc. (1 copy of enclosure, unbound)
Mr. Ralph Basinski (1 copy of enclosure)
Mr. Terry Rojahn (1 copy of enclosure)
Mr. Fred Ramser (1 copy of enclosure)
Mr. Matt Cochran (1 copy of enclosure)
Mr. Frank Wudkwyh (1 copy of enclosure)
Crane Library (1 copy of enclosure)
File Copy – CTO 0166 (letter only)

HEALTH AND SAFETY PLAN
FOR

MINE FILL A (SWMU 12)
MINE FILL B (SWMU 13)
CAST HIGH EXPLOSIVES FILL/INCINERATOR COMPLEX (SWMU 16)
PYROTECHNIC TEST AREA (SWMU 19)

NAVAL SURFACE WARFARE CENTER (NSWC)
CRANE, INDIANA

COMPREHENSIVE LONG-TERM
ENVIRONMENTAL ACTION NAVY (CLEAN) CONTRACT

Submitted to:
Southern Division
Naval Facilities Engineering Command
2155 Eagle Drive
North Charleston, South Carolina 29406

Submitted by:
TetraTech NUS
Foster Plaza 7, 661 Andersen Drive
Pittsburgh, Pennsylvania 15220

CONTRACT NUMBER N62467-94-D-0888
CONTRACT TASK ORDERS 0166


OCTOBER 2003

PREPARED UNDER THE
SUPERVISION OF:



RALPH R. BASINSKI
TASK ORDER MANAGER
TETRA TECH NUS
PITTSBURGH, PENNSYLVANIA

APPROVED FOR SUBMITTAL BY:



MATTHEW M. SOLTIS, CIH, CSP
CLEAN HEALTH AND SAFETY MANAGER
TETRA TECH NUS
PITTSBURGH, PENNSYLVANIA

TABLE OF CONTENTS

<u>Section</u>		<u>Page No.</u>
1.0	INTRODUCTION.....	1-1
1.1	KEY PROJECT PERSONNEL AND ORGANIZATION.....	1-1
1.2	SITE INFORMATION AND PERSONNEL ASSIGNMENTS.....	1-3
2.0	EMERGENCY ACTION PLAN.....	2-1
2.1	INTRODUCTION.....	2-1
2.2	EMERGENCY PLANNING.....	2-1
2.3	EMERGENCY RECOGNITION AND PREVENTION.....	2-2
2.3.1	Recognition.....	2-2
2.3.2	Prevention.....	2-3
2.4	SAFE DISTANCES AND PLACES OF REFUGE.....	2-3
2.5	EVACUATION ROUTES AND PROCEDURES.....	2-3
2.6	DECONTAMINATION PROCEDURES/EMERGENCY MEDICAL TREATMENT.....	2-4
2.7	EMERGENCY ALERTING AND ACTION/RESPONSE PROCEDURES.....	2-4
2.8	PPE AND EMERGENCY EQUIPMENT.....	2-5
2.9	EMERGENCY CONTACTS.....	2-5
2.10	EMERGENCY ROUTE TO HOSPITAL.....	2-7
2.11	INJURY/ILLNESS REPORTING.....	2-10
3.0	SITE BACKGROUND.....	3-1
3.1	SITE HISTORY.....	3-1
3.2	SPECIFIC SITES TO BE INVESTIGATED.....	3-1
3.2.1	SWMU 12 Mine Fill A.....	3-2
3.2.2	SWMU 13 Mine Fill B.....	3-2
3.2.3	SWMU 16 Cast High Explosives/Incinerator Complex.....	3-2
3.2.4	SWMU 19 Pyrotechnic Test Area.....	3-3
4.0	SCOPE OF WORK.....	4-1
5.0	TASKS/HAZARDS/ASSOCIATED CONTROL MEASURES.....	5-1
5.1	GENERAL SAFE WORK PRACTICES.....	5-1
5.2	DRILLING SAFE WORK PRACTICES.....	5-3
5.2.1	Before Drilling.....	5-3
5.2.2	During Drilling.....	5-3
5.2.3	After Drilling.....	5-4
6.0	HAZARD ASSESSMENT.....	6-1
6.1	CHEMICAL HAZARDS.....	6-1
6.1.1	Site Specific Chemical Hazards.....	6-1
6.1.2	Magnesium – Teflon – Viton (MTV).....	6-1
6.2	PHYSICAL HAZARDS.....	6-12
6.2.1	Slips, Trips and Falls.....	6-12
6.2.2	Cuts or Other Injuries Associated with Hand Tool Use.....	6-12
6.2.3	Energized Systems (Contact with Underground and Overhead utilities).....	6-13
6.3	NATURAL HAZARDS.....	6-13
6.3.1	Insect Bites and Stings.....	6-13
6.3.2	Snakes and Other Wild Animals.....	6-15
6.3.3	Poisonous Plants.....	6-17
6.3.4	Inclement Weather.....	6-18

TABLE OF CONTENTS (Continued)

<u>Section</u>	<u>Page No.</u>
7.0 AIR MONITORING	7-1
7.1 INSTRUMENTS AND USE	7-1
7.1.1 Photoionization Detector or Flame Ionization Detector	7-1
7.1.2 Hazard Monitoring Frequency.....	7-1
7.2 INSTRUMENT MAINTENANCE AND CALIBRATION.....	7-2
8.0 TRAINING/MEDICAL SURVEILLANCE REQUIREMENTS	8-1
8.1 INTRODUCTORY/REFRESHER/SUPERVISORY TRAINING.....	8-1
8.1.1 Requirements for TtNUS Personnel	8-1
8.1.2 Requirements for Subcontractors	8-1
8.2 SITE SPECIFIC TRAINING	8-3
8.3 MEDICAL SURVEILLANCE.....	8-3
8.3.1 Medical Surveillance Requirements for TetraTech NUS Personnel	8-3
8.3.2 Medical Surveillance Requirements for Subcontractors	8-5
8.3.3 Requirements for All Field Personnel.....	8-5
8.4 SUBCONTRACTOR EXCEPTION	8-5
9.0 SPILL CONTAINMENT PROGRAM	9-1
9.1 SCOPE AND APPLICATION	9-1
9.2 HAZARDOUS SOILS AND FLUIDS.....	9-1
9.3 POTENTIAL SPILL AREAS	9-1
9.3.1 Site Drums/Containers	9-2
9.4 LEAK AND SPILL DETECTION.....	9-2
9.5 PERSONNEL TRAINING AND SPILL PREVENTION	9-3
9.6 SPILL PREVENTION AND CONTAINMENT EQUIPMENT	9-3
9.7 SPILL CONTROL PLAN	9-3
10.0 SITE CONTROL	10-1
10.1 EXCLUSION ZONE	10-1
10.1.1 Exclusion Zone Clearance	10-1
10.2 CONTAMINATION REDUCTION ZONE	10-1
10.3 SUPPORT ZONE.....	10-2
10.4 SITE VISITORS	10-2
10.5 SITE SECURITY	10-3
10.6 SITE MAP	10-3
10.7 BUDDY SYSTEM.....	10-3
10.8 MATERIAL SAFETY DATA SHEET (MSDS) REQUIREMENTS.....	10-3
10.9 COMMUNICATION.....	10-4
10.10 SAFE WORK PERMITS	10-4
11.0 CONFINED SPACE ENTRY	11-1
12.0 MATERIALS AND DOCUMENTS	12-1
12.1 MATERIALS TO BE POSTED OR MAINTAINED AT THE SITE	12-1
13.0 GLOSSARY	13-1

- ATTACHMENT I – INJURY/ILLNESS PROCEDURE AND REPORT FORM
- ATTACHMENT II – MEDICAL DATA SHEET
- ATTACHMENT III – UTILITY LOCATING AND EXCAVATION CLEARANCE
- ATTACHMENT IV – EQUIPMENT INSPECTION CHECKLIST
- ATTACHMENT V – SAFE WORK PERMITS

FIGURES

<u>Figure</u>		<u>Page No.</u>
2-1	Hospital Route Map (Bedford Gate).....	2-8
2-2	Hospital Route Map (Bloomington Gate)	2-9
2-3	Emergency Response Protocol	2-11
7-1	Documentation of Field Calibration.....	7-3
8-1	Training Letter.....	8-2
8-2	Site Specific Training Documentation.....	8-4
8-3	Subcontractor Medical Approval Form.....	8-6
8-4	Medical Surveillance Letter	8-8
10-1	Safe Work Permit.....	10-5

TABLES

<u>Table</u>		<u>Page No.</u>
2-1	Emergency Reference	2-6
5-1	Tasks/Hazards/Control Measures.....	5-4
6-1	Chemical, Physical, And Toxicological Data	6-8

1.0 INTRODUCTION

This Health and Safety Plan (HASP) is specifically written for site activities that are to be conducted at the Naval Surface Warfare Center Crane (NSWC Crane), located in Crane, Indiana. This investigation will provide data on various chemical concentrations in surface soils at the Mine Fill A (SWMU 12), Mine Fill B (SWMU 13), Cast High Explosives Fill/Incinerator Complex (SWMU 16), and Pyrotechnic Test Area (SWMU 19). In addition to this HASP, a copy of the Tetra Tech NUS, Inc. (TtNUS) Health and Safety Guidance Manual must be at the site during the performance of site activities. This guidance manual provides detailed information pertaining to the HASP as well as TtNUS standard operating procedures (SOPs). Both documents must be present at the site to comply with the requirements stipulated in the Occupational Safety and Health Administration (OSHA) standard 29 Code of Federal Regulations (CFR) 1910.120.

This HASP has been developed using the latest available information regarding known or suspected chemical contaminants and potential physical hazards associated with the proposed work and site activities. This HASP will be modified if new information becomes available. Changes to the HASP will be requested through the TtNUS Health and Safety Manager (HSM) and the Task Order Manager (TOM). It is the responsibility of the TOM to notify affected personnel of changes to this HASP. A Site Safety Follow-up Report will document changes to this HASP.

The elements of this HASP are in compliance with the requirements established by OSHA 29 CFR 1910.120, "Hazardous Waste Operations and Emergency Response" (HAZWOPER) and sections of 29 CFR 1926 "Safety and Health Regulations For Construction." The information contained in this plan, as well as policies on conducting on-site operations, have been obtained from the TtNUS Health and Safety Program and NSWC Crane policies and procedures.

1.1 KEY PROJECT PERSONNEL AND ORGANIZATION

This section defines responsibility for site safety and health for TtNUS and subcontractor employees engaged in on-site activities. Personnel assigned to these positions will exercise the primary responsibility for on-site health and safety. These persons will be the primary points of contact for any questions regarding the safety and health procedures and the selected control measures that are to be implemented for on-site activities.

- The TtNUS TOM is responsible for the overall direction of health and safety for this project.

- The Project Health and Safety Officer (PHSO) is responsible for developing the HASP in accordance with applicable OSHA regulations. Specific responsibilities include:
 - i. providing information regarding site contaminants and physical hazards associated with the site.
 - ii. establishing air monitoring and decontamination procedures.
 - iii. assigning personal protective equipment.
 - iv. determining emergency response procedures and emergency contacts.
 - v. stipulating training requirements and reviewing appropriate training and medical surveillance certificates.
 - vi. providing standard work practices to minimize potential injuries and exposures associated with hazardous waste work.

- The TtNUS Field Operations Leader (FOL) is responsible for implementation of the HASP with the assistance of an appointed Site Safety Officer (SSO). The FOL manages field activities, executes the work plan, and enforces safety procedures as applicable to the work plan.

- The SSO supports site activities by advising the FOL on the aspects of health and safety on-site. These duties may include:
 - i. coordination of health and safety activities with the FOL.
 - ii. selecting, applying, inspecting, and maintaining personal protective equipment.
 - iii. establishing work zones and control points.
 - iv. implementing air monitoring program for on-site activities.
 - v. verification of training and medical status of on-site personnel in relation to site activities.
 - vi. implementation of hazard communication and respiratory protection programs.
 - vii. coordination of emergency services.
 - viii. providing site specific training for on-site personnel.

- Compliance with the requirements stipulated in this HASP is monitored by the SSO and coordinated through the CLEAN Health and Safety Manager.

1.2 SITE INFORMATION AND PERSONNEL ASSIGNMENTS

Site Name: NSWC Crane

Client Contact: Mr. Thomas Brent

Address: Crane, Indiana

Phone Number: (812) 854-6160

Alternate Contact: Ms. Chris Freeman

Phone Number: (812) 854-4423

Project Team:

TtNUS Personnel:

Ralph Basinski

Matthew M. Soltis, CIH, CSP

Clyde J. Snyder

Terry Rojahn

TBD

Terry Rojahn

Discipline/Tasks Assigned:

Task Order Manager (TOM)

Manager of Health and Safety (HSM)

Project Health and Safety Officer (PHSO)

Field Operations Leader (FOL)

Field Technician

Site Safety Officer (SSO)

Non-TtNUS Personnel

TBD

TBD

Affiliation/Discipline/Tasks Assigned

Drilling Subcontractor

Surveyor

Hazard Assessments (for purposes of OSHA 29 CFR 1910.132) and HASP preparation conducted by:

Clyde J. Snyder

2.0 EMERGENCY ACTION PLAN

2.1 INTRODUCTION

This section has been developed as part of a planning effort to direct and guide field personnel in the event of an emergency. In the event of on-site emergencies, which cannot be handled by on-site personnel, site personnel will be evacuated to a safe place of refuge and the appropriate emergency response agencies will be notified. It has been determined that a majority of potential emergency situations would be better supported by outside emergency responders. Based on this determination, TtNUS and subcontractor personnel will not provide emergency response support beyond the capabilities of on-site response. Workers who are ill or who have suffered a non-serious injury may be transported by site personnel to nearby medical facilities, provided that such transport does not aggravate or further endanger the welfare of the injured/ill person. The emergency response agencies listed in this plan are capable of providing the most effective response, and as such, will be designated as the primary responders. These agencies are located within a reasonable distance from the area of site operations, which ensures adequate emergency response time. This emergency action plan conforms to the requirements of OSHA Standard 29 CFR 1910.38(a), as allowed in OSHA 29 CFR 1910.120(l)(1)(ii).

TtNUS will through necessary services, include incidental response measures for incidents such as:

- Incipient stage fire fighting support and prevention.
- Incipient spill control and containment measures and prevention.
- Removal of personnel from emergency situations.
- Provide initial medical support for injuries or illnesses requiring only first-aid level support.
- Provide site control and security measures as necessary.

2.2 EMERGENCY PLANNING

Through the initial hazard/risk assessment effort, injuries or illnesses resulting from exposure to chemical or physical hazards or fire are the most probable emergencies that could be encountered during site activities.

To minimize and eliminate these potential emergency situations, emergency planning activities associated with this project include the following. The SSO and/or the FOL are responsible for:

- Coordinating with NSWCrane Emergency Services personnel to ensure that TtNUS emergency action activities are compatible with existing facility emergency response procedures.
- Establishing and maintaining information at the project staging area (support zone) for easy access in the event of an emergency. This information will include the following:
 - Chemical Inventory (used on-site), with Material Safety Data Sheets.
 - On-site personnel medical records (medical data sheets).
 - A logbook identifying personnel on site each day.

It will be the responsibility of the TtNUS FOL to ensure this information is available and present at the site. Other responsibilities include:

- Identifying a chain of command for emergency action.
- Educating site workers to the hazards and control measures associated with planned activities at the site, and to provide early recognition and prevention where possible.
- Practicing and drilling potential incident response measures periodically.

It is understood that the use of two-way communication devices (cellular phones and radios) must be approved by the NSWCrane Safety Office and such equipment will only be used with official permission. However, TtNUS is authorized to utilize a two-way radio assigned to the Environmental Department. This radio is to be used only in the event of an emergency. It should only be activated if needed as the battery will only be charged periodically throughout the shift.

2.3 EMERGENCY RECOGNITION AND PREVENTION

2.3.1 Recognition

Foreseeable emergency situations that may be encountered during site activities will generally be recognizable by visual observation. Visual observation is primarily relevant for physical hazards that may be associated with the proposed scope of work. Visual observation will also play a role in detecting some chemical overexposures. To adequately recognize exposures to site contaminants, site personnel must have a clear knowledge of signs and symptoms of exposure associated with the site contaminants. This information is provided in Table 6-1 of this HASP. Potential site hazards, the activities unto which they have been associated with, and the recommended control methods are discussed in detail in Section 5.0 and 6.0 of this HASP. Additionally, early recognition of emergency situations will be supported by periodic

site surveys to eliminate any situation predisposed to an emergency. The FOL, and the SSO will make up the site evaluation committee responsible for these periodic surveys. Site surveys will be conducted at least once a week during the initiation of this effort.

The above actions will provide early recognition for potential emergency situations. Should an incident occur, TtNUS will take defensive and offensive measures to control these situations. However, if the FOL and the SSO determine that an incident has progressed to a serious emergency situation, TtNUS will withdraw, and notify the appropriate response agencies.

2.3.2 Prevention

TtNUS and subcontractor personnel will minimize the potential for emergencies by ensuring compliance with the HASP, the Health and Safety Guidance Manual, and applicable OSHA regulations.

2.4 SAFE DISTANCES AND PLACES OF REFUGE

In the event that the site must be evacuated, personnel will immediately stop activities and report to the designated point in the support zone. Telephone communication points and safe places of refuge will be identified prior to the commencement of site activities and will be conveyed to personnel as part of the daily safety meeting conducted each morning. During an evacuation, personnel reporting to the refuge location will remain there until directed otherwise by the TtNUS FOL. The FOL or the SSO will take a head count at this location to account for and to confirm the location of site personnel. The site logbook will be used to take the head count. Emergency response personnel will be immediately notified of any unaccounted personnel.

2.5 EVACUATION ROUTES AND PROCEDURES

An evacuation will be initiated whenever; severe weather is encountered; a fire or explosion occurs; readings on monitoring instrumentation indicate levels of contamination greater than instituted action levels; or if personnel show signs or symptoms of overexposure to potential site contaminants. In the event of an evacuation, personnel will proceed immediately to the designated place of refuge in the support zone, unless doing so would further jeopardize the welfare of workers. In such an event, personnel will proceed to a designated alternate location and remain until further notification from the TtNUS FOL.

Evacuation procedures will be discussed prior to the initiation of any work at the site. Evacuation routes from the site and safe places of refuge are dependent upon the location at which work is being performed

and the circumstances under which an evacuation is required. Additionally, site location and meteorological conditions (i.e., wind speed and direction) may dictate evacuation routes. As a result, assembly points will be selected and communicated to the workers relative to the site location where work is being performed.

2.6 DECONTAMINATION PROCEDURES / EMERGENCY MEDICAL TREATMENT

During an evacuation, decontamination procedures will be performed only if doing so does not further jeopardize the welfare of site workers. Decontamination will not be performed if the action that initiates an evacuation would further endanger the lives of workers if workers were to perform decontamination procedures. However, it is unlikely that an evacuation would occur at this site which would require workers to evacuate the site without first performing decontamination procedures.

2.7 EMERGENCY ALERTING AND ACTION/RESPONSE PROCEDURES

Since TtNUS personnel will be working in close proximity to each other, hand signals, voice commands, and air horns, will be sufficient to alert site personnel of an emergency. If site personnel will be working in remote locations or if site activities are conducted in separate sites simultaneously, two-way radios will be used to communicate between teams of workers.

Note: TtNUS personnel will sign-out a base environmental radio for weekends at a minimum. If available, radios should be utilized during the entire work shift due to the remote location of most work sites. This will give field personnel a direct access to base emergency personnel 24 hours a day 7 days a week. A procedure for radio use will be established by field personnel and NSWC Crane officials.

If an emergency occurs on Base, the following procedures are to be initiated:

- Initiate an evacuation by hand signals, voice commands, air horn, or two-way radios. Report to the designated refuge assembly point in the support zone.
- Describe to the FOL (who will serve as the Incident Coordinator) what has occurred and as many details as possible. Once personnel are evacuated, incipient response procedures will be enacted to control the situation.

In the event that site personnel cannot control the incident through offensive and defensive measures, the FOL and SSO will enact the emergency notification procedures to secure additional outside assistance in the following manner:

- On base call 854-3300 or 864-1333* or other emergency contacts (Table 2-1) and report the emergency. Give the emergency operator the location of the emergency, the type of emergency, the number of injured, and a brief description of what occurred. Stay on the phone and follow the instructions given by the operator. The operator will then notify and dispatch the proper emergency response agencies.

***NOTE:** On-base extensions 3300 and 1333 are the primary emergency phone numbers. From an NSWCC Crane phone, on Base extensions must be preceded by "854," Off-base numbers can only be reached by dialing "991" first. Furthermore, emergencies involving site activities should subsequently be reported to the Environmental Protection Department (x-3114/1132/6160).

- Conduct a head count of site personnel using the site logbook.

2.8 PPE AND EMERGENCY EQUIPMENT

A first aid kit, eye wash units, and fire extinguishers (strategically placed) will be maintained on-site and shall be immediately available for use in the event of an emergency.

2.9 EMERGENCY CONTACTS

Prior to performing work at any of the sites, personnel will be thoroughly briefed on the emergency procedures to be followed in the event of an accident. A mobile phone may be available on site. Table 2-1 provides a list of emergency contacts and their associated telephone numbers. This table must be posted on site where it is readily available to site personnel.

In addition, TtNUS personnel who are injured or become ill on the job must notify appropriate company representatives. Figure 2-3 presents the procedure for reporting an injury/illness, and the form to use for this purpose. **If the emergency involves personnel exposures to chemicals, follow the steps in Figure 2-3.**

TABLE 2-1
EMERGENCY REFERENCE
NSWC CRANE, INDIANA

AGENCY	TELEPHONE
Base Emergency Number (Fire Department, Base Security, Ambulance)	854-3300 or 854-1333
Base Environmental Office	(812) 854-3114
Bedford Ambulance	(812) 279-6545
Bloomington Hospital (Bloomington, IN)	(812) 336-9515
Hospital, Bedford Medical Center (Bedford, IN)	(812) 275-1200
Poison Control Center	1-800-222-1222
National Response Center	1-800-424-8802
Base Contact, Thomas Brent	(812) 854-6160
Contract Task Order Manager, Ralph Basinski	(412) 921-8308
TtNUS Crane Field Office Building 3245	(812) 854-0280
Field Operations Leader, Terry Rojahn	
On-Site	(812) 854-0280
Off-Site (Pittsburgh)	(412) 921-8857
TtNUS Office, Pittsburgh	(412) 921-7090
CLEAN Health and Safety Manager, Matthew M. Soltis, CIH, CSP	(412) 921-8912
Project Health and Safety Officer, Clyde J. Snyder	(412) 921-8904

Note: Most phones require the number to be preceded by 991 (i.e., 991-812-854-0280) or by "99" (if 812 is left off) (i.e., 99-854-0280)

2.10 EMERGENCY ROUTE TO HOSPITAL

Directions to Bedford Regional Medical Center* See Figure 2-1 Hospital Route Map (Bedford Gate)

Exit the base on H-58, through the Bedford Gate. Head West on State Highway 158. State Highway 158 becomes 16th Street upon entering the City of Bedford. The medical center is on the right shortly after Plaza Drive. (2900 16th Street)

Directions to the Bloomington Hospital** See Figure 2-2 Hospital Route Map (Bloomington Gate)

Exit NSWC Crane on H-45 through the Bloomington gate. Follow Highway 45 North to Bloomington at Highway 45 and Highway 37. Continue going straight over the overpass (Bloomfield Road). Follow Bloomfield Road North; this road turns into 2nd Street. Follow 2nd Street, hospital will be on the right (601 West 2nd Street)

Figure 2-1
Hospital Route Map (Bedford Gate)

***Note: The Bedford Gate is open only from 0600 - 0830 and 1500 - 1800 hours.**


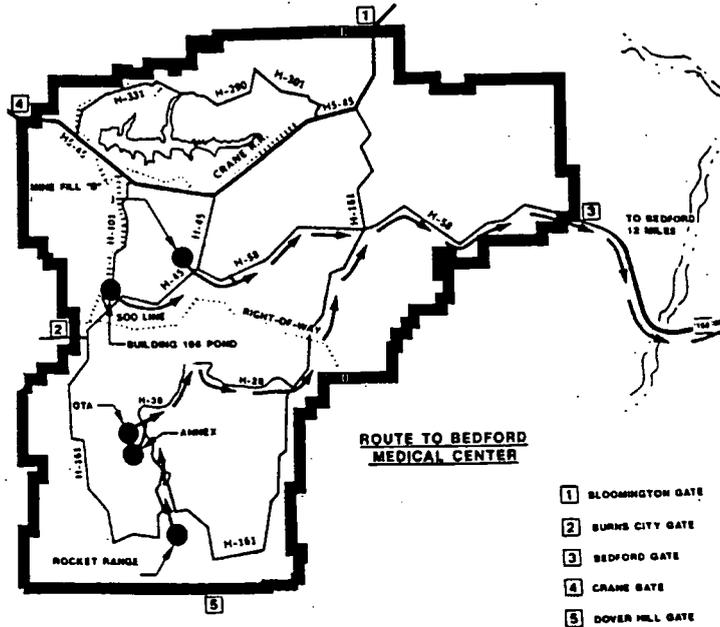


Figure 2-2
Hospital Route Map (Bloomington Gate)

****Note: The Bloomington Gate is open 24 hours.**

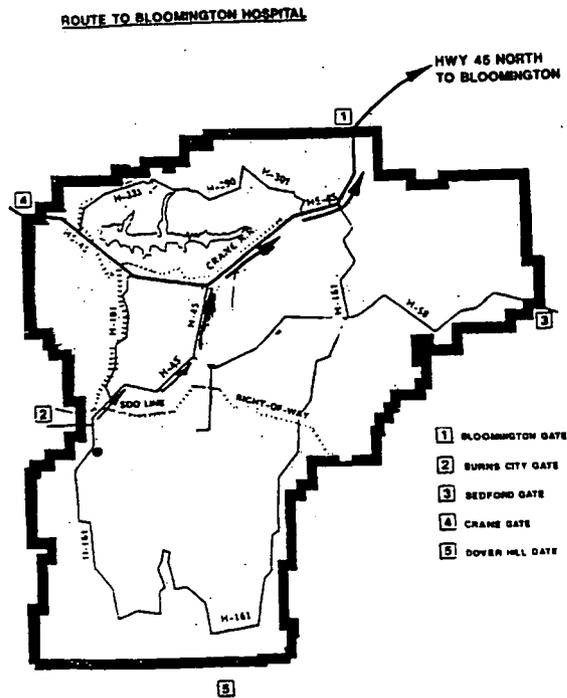

2.11 INJURY/ILLNESS REPORTING

If any TtNUS personnel are injured or develop an illness as a result of working on site, the TtNUS "Injury/Illness Procedure" (Attachment I) must be followed. Following this procedure is necessary for documenting of the information obtained at the time of the incident.

Any pertinent information regarding allergies to medications or other special conditions will be provided to medical service personnel. This information is listed on Medical Data Sheets (Attachment II) filed onsite. If an exposure to hazardous materials has occurred, provide information on the chemical, physical, and toxicological properties of the subject chemical(s) to medical service personnel.

FIGURE 2-3 EMERGENCY RESPONSE PROTOCOL

The purpose of this protocol is to provide guidance for the medical management of injury situations.

In the event of a personnel injury or accident:

- Rescue, when necessary, employing proper equipment and methods.
- Give attention to emergency health problems -- breathing, cardiac function, bleeding, and shock.
- Transfer the victim to the medical facility designated in this HASP by suitable and appropriate conveyance (i.e. ambulance for serious events)
- Obtain as much exposure history as possible (a Potential Exposure report is attached).
- If the injured person is a TtNUS employee, call the medical facility and advise them that the patient(s) is/are being sent and that they can anticipate a call from the WorkCare physician. WorkCare will contact the medical facility and request specific testing which may be appropriate. WorkCare physicians will monitor the care of the victim. Site officers and personnel should not attempt to get this information, as this activity leads to confusion and misunderstanding.
- Call WorkCare at 1-800-455-6155 and enter Extension 109, or follow the voice prompt for after hours and weekend notification and be prepared to provide:
 - Any known information about the nature of the injury.
 - As much of the exposure history as was feasible to determine in the time allowed.
 - Name and phone number of the medical facility to which the victim(s) has/have been taken.
 - Name(s) of the involved TtNUS, Inc. employee(s).
 - Name and phone number of an informed site officer who will be responsible for further investigations.
 - Fax appropriate information to WorkCare at (714) 456-2154.
- Contact Corporate Health and Safety Department (Matt Soltis) and Corporate Human Resources Manager Marilyn Diethorn Duffy at 1-800-245-2730.
- As data is gathered and the scenario becomes more clearly defined, this information should be forwarded to WorkCare.

WorkCare will compile the results of data and provide a summary report of the incident. A copy of this report will be placed in each victim's medical file in addition to being distributed to appropriately designated company officials.

Each involved worker will receive a letter describing the incident but deleting any personal or individual comments. A personalized letter describing the individual findings/results will accompany this generalized summary. A copy of the personal letter will be filed in the continuing medical file maintained by WorkCare.

FIGURE 2-3 (continued)
WORKCARE
POTENTIAL EXPOSURE REPORT

Name: _____ Date of Exposure: _____
Social Security No.: _____ Age: _____ Sex: _____
Client Contact: _____ Phone No.: _____
Company Name: _____

I. Exposing Agent

Name of Product or Chemicals (if known): _____

Characteristics (if the name is not known)

Solid Liquid Gas Fume Mist Vapor

II. Dose Determinants

What was individual doing? _____

How long did individual work in area before signs/symptoms developed? _____

Was protective gear being used? If yes, what was the PPE? _____

Was their skin contact? _____

Was the exposing agent inhaled? _____

Were other persons exposed? If yes, did they experience symptoms? _____

III. Signs and Symptoms (check off appropriate symptoms)

Immediately With Exposure:

Burning of eyes, nose, or throat

Tearing

Headache

Cough

Shortness of Breath

Chest Tightness / Pressure

Nausea / Vomiting

Dizziness

Weakness

Delayed Symptoms:

Weakness

Nausea / Vomiting

Shortness of Breath

Cough

Loss of Appetite

Abdominal Pain

Headache

Numbness / Tingling

IV. Present Status of Symptoms (check off appropriate symptoms)

Burning of eyes, nose, or throat

Tearing

Headache

Cough

Shortness of Breath

Chest Tightness / Pressure

Cyanosis

Nausea / Vomiting

Dizziness

Weakness

Loss of Appetite

Abdominal Pain

Numbness / Tingling

Have symptoms: (please check off appropriate response and give duration of symptoms)

Improved: _____ Worsened: _____ Remained Unchanged: _____

V. Treatment of Symptoms (check off appropriate response)

None: _____ Self-Medicating: _____ Physician Treated: _____

3.0 SITE BACKGROUND

This section provides information pertaining to NSWC Crane and the sites that are to be investigated. This information will be revised if additional information becomes available or if additional sites are going to be investigated.

3.1 SITE HISTORY

NSWC Crane is located in Crane, Indiana approximately 75 miles southwest of Indianapolis and 71 miles northwest of Louisville, Kentucky. The facility encompasses more than 100 square miles (64,463 acres) in Daviess, Greene, Lawrence, and Martin Counties. It is located in a rural, sparsely populated area. The acreage surrounding the base is either wooded or farmed land. The facility, originally called Naval Ammunition Depot (NAD), Burns City, was opened in 1941 to serve as an inland ammunition production and storage center. The Depot's name was changed to NAD, Crane in 1943. In 1975, the name was changed to Naval Weapons Support Center, Crane and in 1992; the name was again changed to Naval Surface Warfare Center, Crane. Today NSWC Crane's mission is to "provide quality and responsive engineering, technical and material support to the Fleet for combat subsystems, equipment and components, microelectronic technology, microwave components, electronic warfare, acoustic sensors tests, engineering pyrotechnics, small arms, electronic module test and system command." Under the Single Service Management Program, a segment of the Center's mission is to provide support (including environmental protection) to the Crane Army Ammunition Activity (CAAA). The Army is tasked with the production and renovation of conventional ammunition and related items, the performance of manufacturing, engineering, and product quality assurance to support production; and the storage, shipment, demilitarization, and disposal of conventional ammunition and related components. Because of the nature of the Army's operations, CAAA contributes significant financial support for the environmental program through an Inter-service Support Agreement.

3.2 SPECIFIC SITES TO BE INVESTIGATED

This HASP covers the CTO 0166 RCRA Phase III Facility Investigation at four Solid Waste Management Units (SWMU) at the NSWC Crane Division. The four SWMUs are located within the Boggs and Turkey Creek Drainage Basin, which is one of five drainage basins that carry surface water off the installation and eventually drain into the East Fork of the White River and then to the Wabash River to the southwest.

Mine Fills A and B are nearly identical units that were used for the production of large mines, depth charges, rocket heads, aerial bombs, and projectiles. In the past, explosives powders discharged from

roof vents and accumulating on roofs were washed down to the ground, resulting in the contamination of soils. Wastewater containing explosives were previously discharged into ditches. An interim removal action was conducted in which explosive-contaminated soils were removed for biological treatment of explosives. Treated soils were then placed onto the areas from which the contaminated soils were removed.

3.2.1 SWMU 12 Mine Fill A

Mine Fill A can be divided into two halves along a central east-west line. The manufacturing and processing operations and facilities in each half are nearly identical. Mine Fill A began operations in December 1941. Mine Fill A continued to produce ordnance until 1975. Production was resumed in 1980, and the mine fill is active today.

3.2.2 SWMU 13 Mine Fill B

As at Mine Fill A, facilities at Mine Fill B can be divided into two halves in which identical activities took place. Operations at Mine Fill B began in December 1941. Mine Fill B has historically been used to manufacture mines, depth charges, rocket heads, aerial bombs, and projectiles. Production of explosive ordnance occurred at Mine Fill B from 1941 until 1973. Since 1973, the facilities at Mine Fill B have been used for renovation of ordnance and equipment.

3.2.3 SWMU 16 Cast High Explosives Fill/Incinerator Complex

The Cast High Explosives Fill/B-146 Incinerator consisted of Building 146 and three oil-fired rotary kiln incinerators with fuel storage tanks. Building 146 is still in existence; it was previously used as an explosive fill and pressure washout facility. The incinerators and fuel storage tanks have been removed. During operation, incinerator ash was stored in waste piles adjacent to the incinerators. These ash piles have also been removed. In previous investigations, sumps receiving roof drain waters and process waters were found to contain trichloroethylene (TCE). These sumps discharged into ditches. After this discovery, a remedial action was conducted in which an air stripper was used to remove VOCs from the sumps and the roof drain waters were rerouted to a separate line discharging into a ditch. After TCE concentrations in the sump were reduced to acceptable levels, the sump drains were rerouted to the sanitary sewerage system.

3.2.4 SWMU 19 Pyrotechnic Test Area

The Pyrotechnic Test Area, which is still active, has been used for the functional testing of flares, signals, and other marking devices for over 40 years. This SWMU consists of three distinct areas – the Ordnance Test Area, Annex, and Rocket Range. No remedial activities have been conducted at the Pyrotechnic Test Area.

4.0 SCOPE OF WORK

This section discusses the activities that are to be performed at the site. Table 5-1 of this HASP provides information related to each of the tasks that are to be performed as part of the scope of work conducted at the site. As new phases or tasks are to be performed at the site, Table 5-1 will be modified accordingly. If tasks other than those presented below are performed at the site, this section will be modified accordingly.

The Field Investigation will consist of the following tasks:

- Mobilization/Demobilization
- Geographical and geophysical survey
- Soil boring activities will include direct push technology (DPT), hand auguring and, if necessary, hollow stem auguring (HSA).
- Multi-Media Sampling including:
 - Surface Soils
 - Subsurface Soils
 - Groundwater
 - Surface water
 - Sediment
- Decontamination of sampling and heavy equipment
- Investigative Derived Waste (IDW) Management

5.0 TASKS/HAZARDS/ASSOCIATED CONTROL MEASURES SUMMARIZATION

Table 5-1 of this section serves as the primary portion of the site specific HASP which identifies the tasks that are to be performed as part of the scope of work. The anticipated hazards, recommended control measures, air monitoring recommendations, required Personal Protective Equipment (PPE), and decontamination measures for each site task are discussed in detail. This table and the associated control measures will be revised, if the scope of work, contaminants of concern or other conditions change.

Through using the table, site personnel can determine which hazards are associated with each task and at each site, and what associated control measures are necessary to minimize potential exposure or injuries related to those hazards. The table also assists field team members in determining which PPE and decontamination procedures to use based on proper air monitoring techniques and site-specific conditions.

A Health and Safety Guidance Manual must accompany this table and the HASP. This will require the FOL to obtain and maintain a Guidance manual on site. The manual is designed to further explain supporting programs and elements for other site-specific aspects as required by 29 CFR 1910.120. The Guidance Manual should be referenced for additional information regarding air monitoring instrumentation, decontamination activities, emergency response, hazard assessments, hazard communication and hearing conservation programs, medical surveillance, PPE, respiratory protection, site control measures, standard work practices, and training requirements. Many of TtNUS' SOPs are also provided in this Guidance Manual.

Safe Work Permits issued for major activities (See Section 10.11) will use elements defined in Table 5-1 as the primary reference. The FOL or the SSO completing the safe work permit will add additional site-specific information. In situations where the safe work permit is more conservative than the direction provided in Table 5-1 due to the incorporation of site-specific elements, the safe work permit will be followed.

5.1 GENERAL SAFE WORK PRACTICES

In addition to the task-specific work practices identified on Table 5-1, the following safe work practices will be observed when conducting work involving known and unknown site hazards. These safe work practices establish a pattern of general precautions and measures for reducing risks associated with hazardous site operations.

- Refrain from eating, drinking, chewing gum or tobacco, taking medication, or smoking in contaminated or potentially contaminated areas or where the possibility for the transfer of contamination exists.
- Wash hands and face thoroughly upon leaving a contaminated or suspected contaminated area. A thorough shower and washing must be conducted as soon as possible if excessive skin contamination occurs.
- Avoid contact with potentially contaminated substances by walking around puddles, pools, mud, or other such areas. Avoid, whenever possible, kneeling on the ground or leaning or sitting on equipment. Do not place monitoring equipment on potentially contaminated surfaces.
- Be familiar with and adhere to the instructions in the site-specific HASP.
- Be aware of the location of the nearest telephone and all emergency telephone numbers. See Section 2.0, Table 2-1.
- Attend briefings on anticipated hazards, equipment requirements, Safe Work Permits, emergency procedures, and communication methods before going on site.
- Plan and mark entrance, exit, and emergency escape routes. See Section 2.0.
- Rehearse unfamiliar operations prior to implementation.
- Maintain visual contact with each other and with other on-site team members by remaining in close proximity in order to assist each other in case of emergency.
- Establish appropriate Safety Zones including Support, Contamination Reduction, and Exclusion Zones.
- Minimize the number of personnel and equipment in contaminated areas (such as the Exclusion Zone). Non-essential vehicles and equipment should remain within the Support Zone.
- Establish appropriate decontamination procedures for leaving the site.
- Immediately report all injuries, illnesses, and unsafe conditions, practices, and equipment to the Site Safety Officer (SSO).
- Observe coworkers for signs of toxic exposure and heat or cold stress.
- Inform co-workers of potential symptoms of illness, such as headaches, dizziness, nausea, or blurred vision.

5.2 DRILLING SAFE WORK PRACTICES

The following safe work practices are to be followed when working in or around the Hollow Stem Drill Rig and/or Direct Push Drill Rig operations.

5.2.1 Before Drilling

- Identify all underground utilities and buried structures before drilling. Use the Utility Locating and Excavation Clearance Standard Operating Procedure provided in Attachment IV.
- All drill rigs will be inspected by a Competent Person (the SSO or designee), prior to the acceptance of the equipment at the site and prior to the use of the equipment. All repairs or deficiencies identified will be corrected prior to use. The inspection will be accomplished using the Equipment Inspection Checklist provided in Attachment III. Inspection frequencies will be once every 10-day shift or following repairs.
- The work area around the point of operation will be graded to the extent possible to remove any trip hazards near or surrounding operating equipment.
- The driller's helper will establish an equipment staging and lay down area plan. The purpose of this is to keep the work area clear of clutter and slips, trips, and fall hazards. Mechanisms to secure heavy objects such as drill flights will be provided to avoid the collapse stacked equipment.
- All potentially contaminated tooling will be wrapped in polyethylene sheeting for storage and transport to the centrally located decontamination unit.

5.2.2 During Drilling

- Minimize contact to the extent possible with contaminated tooling and environmental media.
- Support functions (sampling and screening stations) will be maintained a minimum distance from the drill rig of the height of the mast plus five feet to remove these activities from within physical hazard boundaries.
- Only qualified operators and knowledgeable ground crew personnel will participate in the operation of the drill rig.

- In order to minimize contact with potentially contaminated tooling and media and to minimize lifting hazards, multiple personnel should move auger flights and other heavy tooling.
- Only personnel absolutely essential to the work activity will be allowed in the exclusion zone. Site visitors will be escorted at all times.

5.2.3 After Drilling

- All equipment used within the exclusion zone will undergo a complete decontamination and evaluation by the SSO to determine cleanliness prior to moving to the next location, exiting the site, or prior to down time for maintenance.
- All motorized equipment will be fueled prior to the commencement of the day's activities. During fueling operations all equipment will be shutdown and bonded to the fuel provider.
- When not in use all direct push drill rigs will be shutdown, and emergency brakes set. All Hollow Stem Auger Drill Rigs will have their wheels chocked to assist in controlling movement.
- All areas subjected to subsurface investigative methods will be restored to equal or better condition than original to remove any contamination brought to the surface and to remove any physical hazards. In situations where these hazards cannot be removed these areas will be barricaded to minimize the impact on field crews working in the area.

**TABLE 5-1
TASKS/HAZARDS/CONTROL MEASURES
NAVAL SURFACE WARFARE CENTER CRANE DIVISION, CRANE, INDIANA**

Tasks/Operation/ Locations	Anticipated Hazards	Recommended Control Measures	Hazard Monitoring	Personal Protective Equipment <i>(Items in italics are deemed optional as conditions of the FOL or SSO require.)</i>	Decontamination Procedures
Mobilization/ Demobilization	<p><i>Physical Hazards</i></p> <ol style="list-style-type: none"> 1) Lifting (strain/muscle pulls) 2) Pinches and compressions 3) Slips, trips, and falls 4) Heavy equipment hazards (rotating equipment, hydraulic lines, etc.) 5) Vehicular and foot traffic 6) Ambient temperature extremes (cold stress) <p><i>Natural hazards</i></p> <ol style="list-style-type: none"> 7) Insect/animal bites and stings, poisonous plants, etc. 8) Inclement weather 	<ol style="list-style-type: none"> 1) Use machinery or multiple personnel for heavy lifts. Use proper lifting techniques. 2) Keep any machine guarding in place. Avoid moving parts. Use tools or equipment where necessary to avoid contacting pinch points. 3) Preview work locations for unstable/uneven terrain. 4) All equipment will be <ul style="list-style-type: none"> - Inspected in accordance with OSHA and manufacturer's design. - Operated by knowledgeable operators and ground crew. 5) Traffic and equipment considerations are to include the following: <ul style="list-style-type: none"> - Establish safe zones of approach (i.e. Boom + 5 feet). - Secure all loose articles. - All equipment shall be equipped with movement warning systems. - All activities are to be conducted consistent with the site requirements. 6) Wear appropriate clothing for weather conditions. Provide acceptable shelter and liquids for field crews. Additional information regarding cold stress is provided in Section 4 of the Health and Safety Guidance Manual. 7) Avoid nesting areas, use repellents. Report potential hazards to the SSO. Follow guidance presented in Section 4 of the Health and Safety Guidance Manual. 8) Suspend or terminate operations until directed otherwise by SSO. 	Not required	<p>Level D - (Minimum Requirements)</p> <ul style="list-style-type: none"> - Standard field attire (Sleeved shirt; long pants) - Steel toe safety shoes - <i>Safety glasses</i> - <i>Hardhat (when overhead hazards exists, or identified as a operation requirement)</i> - <i>Reflective vest for high traffic areas</i> - <i>Hearing protection for high noise areas, or as directed on an operation by operation scenario.</i> 	Not required
Decontamination of Sampling and Heavy Equipment.	<p><i>Chemical Hazards</i></p> <ol style="list-style-type: none"> 1) Potential contaminants of concern include VOCs, SVOCs, metals, and explosives. None of the contaminants are anticipated to be present in concentrations that would present an inhalation hazard. Table 6-1 provides additional information about each of the identified contaminants of concern. 2) Decontamination fluids - Liquinox (detergent), acetone or isopropanol <p><i>Physical Hazards</i></p> <ol style="list-style-type: none"> 3) Lifting (strain/muscle pulls) 4) Noise in excess of 85 dBA 5) Flying projectiles 6) Vehicular and foot traffic 7) Ambient temperature extremes (cold stress) 8) Slips, trips, and falls <p><i>Natural Hazards</i></p> <ol style="list-style-type: none"> 9) Inclement weather 	<ol style="list-style-type: none"> 1) and 2) Use protective equipment to minimize contact with site contaminants and hazardous decontamination fluids. Obtain manufacturer's MSDS for any decontamination fluids used on-site. These must be used in well-ventilated areas, such as outdoors. Use appropriate PPE as identified on MSDS. All chemicals used must be listed on the Chemical Inventory for the site, and site activities must be consistent with the Hazard Communication section of the Health and Safety Guidance Manual (Section 5). 3) Use multiple persons where necessary for lifting and handling sampling equipment for decontamination purposes. 4) Wear hearing protection when operating pressure washer. 5) Use eye and face protective equipment when operating pressure washer. All other personnel must be restricted from the area. 6) Traffic and equipment considerations are to include the following: <ul style="list-style-type: none"> - Establish safe zones of approach. - All equipment shall be equipped with movement warning systems. - All activities are to be conducted consistent with the site requirements. 7) Wear appropriate clothing for weather conditions. Provide acceptable shelter and liquids for field crews. Additional information regarding cold stress is provided in Section 4 of the Health and Safety Guidance Manual. 8) Preview work locations for unstable/uneven terrain. 9) Suspend or terminate operations until directed otherwise by SSO. 	Use visual observation and real-time monitoring instrumentation to ensure all equipment has been properly cleaned of contamination and dried. After decon is completed, screen equipment with a PID/FID. If any elevated readings (i.e., above background) are observed, perform decon again and re-screen. Repeat until no elevated PID/FID readings are noted.	<p>For Heavy Equipment This applies to high-pressure soap/water, steam cleaning wash and rinse procedures.</p> <p>Level D Minimum requirements -</p> <ul style="list-style-type: none"> - Standard field attire (Long sleeve shirt; long pants) - Steel toe safety shoes - Chemical resistant boot covers - Nitrile outer gloves - Safety glasses underneath a splash shield - Hearing protection (plugs or muffs) - <i>PVC Rain suits or PE or PVC coated Tyvek</i> <p>For sampling equipment (trowels, MacroCore Samplers, bailers, etc.), the following PPE is required</p> <p>Note: Consult MSDS for PPE guidance. Otherwise, observe the following.</p> <p>Level D Minimum requirements -</p> <ul style="list-style-type: none"> - Standard field attire (Long sleeve shirt; long pants) - Steel toe safety shoes - Nitrile outer gloves - Safety glasses <p>In the event of over spray of chemical decontamination fluids employ PVC Rain suits or PE or PVC coated Tyvek as necessary.</p> <p>Note: The Safe Work Permit(s) for this task (see Attachment IV) will be issued at the beginning of each day to address the tasks planned for that day. As part of this task, additional PPE may be assigned to reflect site-specific conditions or special considerations or conditions associated with any identified task.</p>	<p>Personnel Decontamination will consist of a soap/water wash and rinse for reusable outer protective equipment (boots, gloves, PVC splash suits, as applicable). The decon function will take place at an area adjacent to the site activities. This procedure will consist of:</p> <ul style="list-style-type: none"> - Equipment drop - Soap/water wash and rinse of outer boots and gloves, as applicable - Soap/water wash and rinse of the outer splash suit, as applicable - Disposable PPE will be removed and bagged. <p>Equipment Decontamination - All heavy equipment decontamination will take place at a centralized decontamination pad utilizing steam or pressure washers. Heavy equipment will have the wheels and tires cleaned along with any loose debris removed, prior to transporting to the central decontamination area. All site vehicles will have restricted access to exclusion zones, and have their wheels/tires sprayed off as not to track mud onto the roadways servicing this installation. Roadways shall be cleared of any debris resulting from the onsite activity.</p> <p>Sampling Equipment Decontamination</p> <p>Sampling equipment will be decontaminated as per the requirements in the Quality Assurance Project Plan.</p> <p>MSDS for any decon solutions (Alconox, isopropanol, etc.) will be obtained and used to determine proper handling / disposal methods and protective measures (PPE, first-aid, etc.).</p> <p>All equipment used in the exclusion zone will require a complete decontamination between locations and prior to removal from the site.</p> <p>The FOL or the SSO will be responsible for evaluating equipment arriving on-site and leaving the site. No equipment will be authorized access or exit without this evaluation.</p>

TABLE 5-1
TASKS/HAZARDS/CONTROL MEASURES
NAVAL SURFACE WARFARE CENTER CRANE DIVISION, CRANE, INDIANA

Tasks/Operation/ Locations	Anticipated Hazards	Recommended Control Measures	Hazard Monitoring	Personal Protective Equipment <i>(Items in italics are deemed optional as conditions or the FOL or SSO require):</i>	Decontamination Procedures
<p>Multi-media sampling, including soil and water (surface and subsurface).</p>	<p><i>Chemical Hazards</i></p> <p>1) Potential contaminants of concern include VOCs, SVOCs, metals, and explosives. None of the contaminants are anticipated to be present in concentrations that would present an inhalation hazard. Table 6-1 provides additional information about each of the identified contaminants of concern.</p> <p>2) Transfer of contamination into clean areas</p> <p><i>Physical hazards</i></p> <p>3) Noise in excess of 85 dBA</p> <p>4) Lifting (strain/muscle pulls)</p> <p>5) Pinches and compressions</p> <p>6) Slips, trips, and falls</p> <p>7) Ambient temperature extremes (cold stress)</p> <p>8) Vehicular and foot traffic</p> <p><i>Natural hazards</i></p> <p>9) Insect/animal bites and stings, poisonous plants, etc.</p> <p>10) Inclement weather</p>	<p>1) Use real-time monitoring instrumentation, action levels, and identified PPE to control exposures to potentially contaminated media such as air, water, and soils. Generation of dusts should be minimized. If airborne dusts are observed, area-wetting methods may be used. If area-wetting methods are not feasible, activities must be suspended until dust levels subside, or until an acceptable alternative control method can be selected.</p> <p>2) Decontaminate all equipment and supplies between sampling locations and prior to leaving the site.</p> <p>3) When sampling at the operating DPT rig use hearing protection. The use of hearing protection outside of 25 feet from the DPT rig should be incorporated under the following condition: <i>If you have to raise your voice to talk to someone who is within 2 feet of your location, hearing protection must be worn.</i></p> <p>4) Use machinery or multiple personnel for heavy lifts. Use proper lifting techniques.</p> <p>5) Avoid moving parts. Use tools or equipment where necessary to avoid contacting pinch points. - A remote sampling device must be used to sample drill cuttings near rotating tools. The equipment operator shall shutdown machinery if the sampler is near moving machinery parts.</p> <p>6) Preview work locations for unstable/uneven terrain.</p> <p>7) Wear appropriate clothing for weather conditions. Provide acceptable shelter and liquids for field crews. Additional information regarding cold stress is provided in Section 4 of the Health and Safety Guidance Manual.</p> <p>8) Traffic and equipment considerations are to include the following: - Establish safe zones of approach (i.e. Boom + 5 feet). See Section 9 of the HASP for specific safety zones based on media being sampled. - All equipment shall be equipped with movement warning systems. - All activities are to be conducted consistent with the site requirements.</p> <p>9) Avoid nesting areas, use repellents. Report potential hazards to the SSO. Follow guidance presented in Section 4 of the Health and Safety Guidance Manual.</p> <p>10) Suspend or terminate operations until directed otherwise by the SSO.</p>	<p>A direct reading Photoionization Detector (PID) with a 10.6 eV lamp or higher, or a Flameionization Detector (FID), will be used to screen samples and to detect the presence of any potential volatile organics. Source monitoring of the sample collection area will be conducted at regular intervals to be determined by the SSO. Positive sustained results at a source or downwind location(s) which may impact operations crew will require the following actions:</p> <ul style="list-style-type: none"> - Monitor the breathing zone of at-risk and downwind employees. Any sustained readings (greater than 1 minute in duration) above background in the breathing zone of the at-risk employees requires site activities to be suspended and site personnel to retreat to an unaffected area. - Work may only resume if airborne readings in worker breathing zone return to below background. If elevated readings in worker breathing zone persist, the PHSO and HSM will be contacted to determine necessary actions and levels of protection. <p>Site contaminants may adhere to or be part of airborne dusts or particulates generated during site activities. Generation of dusts should be minimized to avoid inhalation of contaminated dusts or particulates. Evaluation of dust concentrations will be performed by observing work conditions for visible dust clouds. Potential exposure to contaminated dust will be controlled using water suppression, by avoiding dust plumes, or evacuating the operation area until dust subsides.</p>	<p>Level D protection will be utilized for the initiation of all sampling activities.</p> <p>Level D - (Minimum Requirements)</p> <ul style="list-style-type: none"> - Standard field attire (Sleeved shirt; long pants) - Steel toe safety shoes - Safety glasses - Surgical style gloves (<i>double-layered if necessary</i>) - <i>Reflective vest for high traffic areas</i> - <i>Hardhat (when overhead hazards exists, or identified as a operation requirement)</i> - <i>Tyvek coveralls and disposable boot covers if surface contamination is present or if the potential for soiling work attire exists.</i> - <i>Hearing protection for high noise areas, or as... directed on an operation by operation scenario.</i> <p>Note: The Safe Work Permit(s) for this task (see Attachment IV) will be issued at the beginning of each day to address the tasks planned for that day. As part of this task, additional PPE may be assigned to reflect site-specific conditions or special considerations or conditions associated with any identified task.</p>	<p>Personnel Decontamination will consist of a removal and disposal of non-reusable PPE (gloves, coveralls, etc., as applicable). The decon function will take place at an area adjacent to the site activities. This procedure will consist of:</p> <ul style="list-style-type: none"> - Equipment drop - Outer coveralls, boot covers, and/or outer glove removal (as applicable) - Removal, segregation, and disposal of non-reusable PPE in bags/containers provided - Soap/water wash and rinse of reusable PPE (e.g., hardhat) if potentially contaminated - Wash hands and face, leave contamination reduction zone.

**TABLE 5-1
TASKS/HAZARDS/CONTROL MEASURES
NAVAL SURFACE WARFARE CENTER CRANE DIVISION, CRANE, INDIANA**

Tasks/Operation/ Locations	Anticipated Hazards	Recommended Control Measures	Hazard Monitoring	Personal Protective Equipment <i>(Items in italics are deemed optional as conditions or the FOL or SSO require.)</i>	Decontamination Procedures
<p>Soil borings using Direct-Push Technology (Geoprobe®), hollow stem and hand auger methods.</p>	<p><i>Chemical Hazards</i></p> <p>1) Potential contaminants of concern include VOCs, SVOCs, metals, and explosives. None of the contaminants are anticipated to be present in concentrations that would present an inhalation hazard. Table 6-1 provides additional information about each of the identified contaminants of concern.</p> <p>2) Transfer of contamination into clean areas or onto persons</p> <p><i>Physical hazards</i></p> <p>3) Heavy equipment hazards (pinch/compression points, rotating equipment, hydraulic lines, etc.)</p> <p>4) Noise in excess of 85 dBA</p> <p>5) Energized systems (contact with underground or overhead utilities)</p> <p>6) Lifting (strain/muscle pulls)</p> <p>7) Slips, trips, and falls</p> <p>8) Vehicular and foot traffic</p> <p>9) Ambient temperature extremes (cold stress)</p> <p>10) Flying projectiles</p> <p><i>Natural hazards</i></p> <p>11) Insect/animal bites and stings, poisonous plants, etc.</p> <p>12) Inclement weather</p>	<p>1) Use real-time monitoring instrumentation, action levels, and identified PPE to control exposures to potentially contaminated media such as air, water, and soils. Generation of dusts should be minimized. If airborne dusts are observed, area-wetting methods may be used. If area-wetting methods are not feasible, activities must be suspended until dust levels subside, or until an acceptable alternative control method can be selected.</p> <p>2) Decontaminate all equipment and supplies between boreholes and prior to leaving the site.</p> <p>3) All equipment to be used will be</p> <ul style="list-style-type: none"> - Inspected in accordance with Federal safety and transportation guidelines, OSHA (1926.600, .601, .602), and manufacturers design and documented as such using Equipment Inspection Sheet (see Attachment III of this HASP). - Operated by knowledgeable operators and ground crew. - Repaired using only manufacturer approved parts and equipment. <p>In addition to the equipment considerations, the following standard operating procedures will be employed:</p> <ul style="list-style-type: none"> - All personnel not directly supporting the drilling operation will remain at least the mast height plus 5 feet from the point of operation. - All loose clothing/protective equipment will be secured to avoid possible entanglement. - Hand signals will be established prior to the commencement of drilling activities. - A remote sampling device must be used to sample drill cuttings near rotating tools. - Work areas will be kept clear of clutter. - All personnel will be instructed in the location and operation of the emergency shut off device(s) for DPT rigs (if applicable). This device will be tested initially (and then periodically) to insure its operational status. - Areas will be inspected prior to the movement of DPT rigs and support vehicles to eliminate any physical hazards. This will be the responsibility of the FOL and/or SSO. <p>4) Hearing protection will be used during all subsurface activities using the DPT rig.</p> <p>5) All drilling activities must proceed in accordance with the TINUS SOP "Utility Locating and Excavation Clearance" (see Attachment II of this HASP). All utility clearances must be obtained, in writing, prior to activities. Also, prior to any subsurface investigations, the locations of all underground utilities must be identified and marked. Overhead utilities must be identified per the SOP.</p> <p>6) Use machinery or multiple personnel for heavy lifts. Use proper lifting techniques.</p> <p>7) Preview work locations for unstable/uneven terrain.</p> <p>8) Traffic and equipment considerations are to include the following:</p> <ul style="list-style-type: none"> - Establish safe zones of approach (i.e. Boom + 5 feet). See Section 9 of the HASP for specific safety zones based on media being sampled. - All equipment shall be equipped with movement warning systems. - All activities are to be conducted consistent with the site requirements. <p>9) Wear appropriate clothing for weather conditions. Provide acceptable shelter and liquids for field crews. Additional information regarding cold stress is provided in Section 4 of the Health and Safety Guidance Manual.</p> <p>10) Wear eye protection (safety glasses) when DPT rig is operating. All other personnel must be restricted from the area.</p> <p>11) Avoid nesting areas, use repellents. Wear appropriate clothing. Report potential hazards to the SSO. Follow guidance presented in Section 4 of the Health and Safety Guidance Manual.</p> <p>12) Suspend or terminate operations until directed otherwise by SSO.</p>	<p>A direct reading Photoionization Detector (PID) with a 10.6 eV lamp or higher, or a Flameionization Detector (FID), will be used to screen the work area to detect the presence of any potential volatile organics. Source monitoring of the borehole will be conducted at regular intervals to be determined by the SSO. Positive sustained results at a source or downwind location(s) which may impact operations crew will require the following actions:</p> <ul style="list-style-type: none"> - Monitor the breathing zone of at-risk and downwind employees. Any sustained readings (greater than 1 minute in duration) above background in the breathing zone of the at-risk employees requires site activities to be suspended and site personnel to retreat to an unaffected area. - Work may only resume if airborne readings in worker breathing zones return to below background. If elevated readings in worker breathing zone persist, the PHSO and HSM will be contacted to determine necessary actions and levels of protection. <p>Site contaminants may adhere to or is part of airborne dusts or particulates generated during site activities. Generation of dusts should be minimized to avoid inhalation of contaminated dusts or particulates. Evaluation of dust concentrations will be performed by observing work conditions for visible dust clouds. Potential exposure to contaminated dust will be controlled using water suppression, by avoiding dust plumes, or evacuating the operation area until dust subsides.</p>	<p>All subsurface operations are to be initiated in Level D protection. Level D protection constitutes the following minimum protection</p> <ul style="list-style-type: none"> - Standard field attire (Sleeved shirt; long pants) - Steel toe safety shoes - Safety glasses - Hardhat - Hearing protection during soil boring activities and for other high noise areas as directed by the SSO. - Nitrile gloves or leather gloves with surgical style inner gloves - <i>Reflective vest for traffic areas</i> - <i>Tyvek coveralls and disposable boot covers if surface contamination is present or if the potential exists for soiling work attire.</i> <p>Note: The Safe Work Permit(s) for this task (see Attachment IV) will be issued at the beginning of each day to address the tasks planned for that day. As part of this task, additional PPE may be assigned to reflect site-specific conditions or special considerations or conditions associated with any identified task.</p>	<p>Personnel Decontamination - Will consist of a soap/water wash and rinse for reusable protective equipment (e.g., gloves). This function will take place at an area adjacent to the drilling operations bordering the support zone.</p> <p>This decontamination procedure for Level D protection will consist of</p> <ul style="list-style-type: none"> - Equipment drop - Soap/water wash and rinse of reusable outer gloves, as applicable - Outer coveralls, boot covers, and/or outer glove removal - Removal, segregation, and disposal of non-reusable PPE in bags/containers provided - Wash hands and face, leave contamination reduction zone.

**TABLE 5-1
TASKS/HAZARDS/CONTROL MEASURES
NAVAL SURFACE WARFARE CENTER CRANE DIVISION, CRANE, INDIANA**

Tasks/Operation/ Locations	Anticipated Hazards	Recommended Control Measures	Hazard Monitoring	Personal Protective Equipment <i>(Items in italics are deemed optional as conditions or the FOL or SSO require.)</i>	Decontamination Procedures
Surveying – Geographical and Geophysical	<p><i>Chemical hazards:</i></p> <p>Significant exposure to site contaminants is anticipated to be unlikely given the nature of this task.</p> <p><i>Physical hazards:</i></p> <p>1) Slips, trips, and falls</p> <p>2) Ambient temperature extremes (cold stress)</p> <p><i>Natural Hazards:</i></p> <p>3) Inclement weather</p> <p>4) Insect/animal bites or stings, poisonous plants, etc.</p>	<p>1) Preview work locations and site lines for uneven and unstable terrain. Clear necessary vegetation, establish temporary means for traversing hazardous terrain (i.e., rope ladders, etc.)</p> <p>2) Wear appropriate clothing for weather conditions. Provide acceptable shelter and liquids for field crews. Additional information regarding cold stress is provided in Section 4 of the Health and Safety Guidance Manual.</p> <p>3) Suspend or terminate operations until directed otherwise by SSO</p> <p>4) Avoid nesting areas, use repellents. Report potential hazards to the SSO. Follow guidance presented in Section 4 of the Health and Safety Guidance Manual.</p>	<p>Air monitoring is not needed. The potential for exposure to site contaminants during this activity is considered minimal.</p>	<p>Surveying activities shall be performed in Level D protection</p> <p>Level D Protection consists of the following:</p> <ul style="list-style-type: none"> - Standard field dress including sleeved shirt and long pants - Steel toe safety shoes - <i>Safety glasses, hard hats (if working near machinery)</i> - <i>Snake chaps for heavily wooded area where encounters are likely.</i> - <i>Tyvek coveralls may be worn to provide additional protection against poisonous plants and insects particularly ticks. Work gloves may be worn if desired.</i> <p>Note: The Safe Work Permit(s) for this task (see Attachment IV) will be issued at the beginning of each day to address the tasks planned for that day. As part of this task, additional PPE may be assigned to reflect site-specific conditions or special considerations or conditions associated with any identified task.</p>	<p>Personnel Decontamination - A structured decontamination is not required as the likelihood of encountering contaminated media is considered remote. However, survey parties should inspect themselves and one another for the presence of ticks when exiting wooded areas, grassy fields, etc. This action will be employed to stop the transfer of these insects into vehicles, homes, and offices.</p>
IDW Management	<p><i>Chemical hazards:</i></p> <p>The only anticipated hazard associated with IDW management is the potential for a spill.</p> <p><i>Physical hazards:</i></p> <p>1) Lifting Hazards/Back Injuries</p> <p>2) Compression Injuries</p> <p>3) Loading bulk transport containers</p> <p><i>Natural Hazards:</i></p> <p>4) Inclement weather</p> <p>5) Insect/animal bites or stings, poisonous plants, etc.</p>	<p>1 & 2) Strains and sprains (lifting hazards)/Back Injuries</p> <ul style="list-style-type: none"> - Use machinery (preferred method) or multiple personnel for heavy lifts. - Use proper lifting techniques including - Lift with your legs, not your back, bend your knees move as close to the load as possible, and ensure good hand holds are available. - Minimize the horizontal distance to the center of the lift to your center of gravity. - Minimize turning and twisting when lifting as the lower back is especially vulnerable at this time. - Break lifts into steps if the vertical distance (from the start point to the placement of the lift) is excessive. - Plan your lifts – Place heavy items on shelves between the waist and chest; lighter items on higher shelves. - Periods of high frequency lifts or extended duration lifts should provide sufficient breaks to guard against fatigue and injury. <p>3) Compression injuries – material-handling devices shall be used for moving drums. This includes drum dollies with pneumatic tires, drum grapplers, etc. These pieces of equipment are engineered to allow placement of these containers while removing hands from the point of operation.</p> <p>4) Suspend or terminate operations until directed otherwise by SSO</p> <p>5) Avoid nesting areas, use repellents. Report potential hazards to the SSO. Follow guidance presented in Section 4 of the Health and Safety Guidance Manual.</p>	<p>None Required, unless spill containment provisions are invoked. Then monitoring will proceed as described in the activity associated with the task when the materials were generated such as Soil boring or well installation.</p>	<p>Level D - (Minimum Requirements)</p> <ul style="list-style-type: none"> - Standard field attire (Sleeved shirt; long pants) - Steel toe safety shoes. - Leather or canvas work gloves - <i>Safety glasses (When utilizing cables or slings to move the containers)</i> - <i>Hardhat (when overhead hazards exists, or identified as a operation requirement)</i> <p>PPE changes may be made with the implementation of the Spill Containment Program. This represents the only anticipated modification to this level of protection.</p>	<p>Not required, unless the implementation of the Spill Containment Program is required due to a spill and/or release. At that point the decontamination procedures for those activities such as soil borings and/or well installation. The reference reflects the tasks conducted when the materials were generated.</p>

6.0 HAZARD ASSESSMENT

The following section provides information regarding the chemical and physical hazards associated with the activities that are to be conducted as part of the scope of work. Table 6-1 provides information related to the chemical hazards that may be present at the site. Specifically, toxicological information, exposure limits, symptoms of exposure, physical properties, and air monitoring and sampling data are discussed in the table. It should be noted that the contaminants of concern might vary between tasks.

6.1 CHEMICAL HAZARDS

The potential health hazards associated with the scope of work include inhalation, ingestion, and dermal contact of site contaminants. Exposure is most likely to occur through ingestion and inhalation of contaminated soil or water, or hand-to-mouth contact. For this reason, PPE and basic hygiene practices (washing face and hands before leaving site) is extremely important. Each site is different with the known chemicals of concern listed below.

6.1.1 Site Specific Chemical Hazards

SWMU 12 Mine Fill A - Contaminants likely to be present at this SWMU include explosives, semi volatile organic compounds (SVOCs), volatile organic compounds (VOCs), and metals.

Building	Chemicals
150	No. 2 Fuel Oil
155	MEK, Toluene, Naphtha
2714	Aluminum powder
B-3110	Contaminated rinse water (TNT, HMX, RDX)

SWMU 13 Mine Fill B - Contaminants likely to be present at this SWMU include explosives, SVOCs, dioxins, PCBs, and metals.

Building	Chemicals
166	TNT, RDX, HMX, PCBs
167	TNT, RDX, HMX
169	Titanium tetrachloride, Vanadium oxytrichloride
171	TNT, RDX, HMX, PCBs
172	TNT, RDX, HMX
174	TNT, RDX, HMX
177	PCBs
2501	TNT, RDX, HMX
2503	TNT, RDX, HMX

SWMU 16 Cast High Explosives Fill/Incinerator Complex - Contaminants likely to be present at this SWMU are explosives, SVOCs, VOCs, dioxins, and metals.

Building	Chemicals
146	Cadmium, Chromium, Lead, Mercury, Zinc, TCE and PCBs

SWMU 19 Pyrotechnic Test Area - No remedial activities have been conducted at the Pyrotechnic Test Area.

Area	Contaminants
Ordnance Test Range	Chlorates, dyes, oxidizers, fuels, inorganic salts,
Annex	Magnesium Teflon Viton (MTV) and other explosive residues and by-products
Rocket Range	Cyanide, chlorate, perchlorate and nitrate

It is not anticipated that contamination levels will be encountered that are of concern to field crews. Exposure (via inhalation, ingestion, or skin contact) to these contaminants will be minimized through the use of PPE and good hygiene practices.

For further information on these contaminants and other potential contaminants see Table 6-1.

6.1.2 Magnesium – Teflon – Viton (MTV)

MTV is a pyrotechnic used in igniter compositions and infrared flare decoys. It is currently manufactured using a crash precipitation method called the "shock-gel" process. Although the process is extremely effective in coating the magnesium and Teflon, it is a hazardous process that generates large amounts of hazardous waste and constantly releases VOC's and toxic air pollutants to the environment. The "shock-gel" process is a lengthy batch process that requires a large quantity of solvent (acetone and hexane) to effectively coat the magnesium and Teflon with the Viton binder. The process begins by dissolving the Viton binder in acetone. Magnesium and Teflon powders are then added to the solution and mixed. Once the solids are properly dispersed throughout the mix, the mixture is shocked with hexane to precipitate the binder out of solution onto the solid particles. The solvent is then decanted from the mixture and the procedure is repeated to ensure that all the remaining acetone is washed from the pyrotechnic. The solvent wet powder is manually transferred to an oven and dried to drive off the remaining volatiles. At this point the MTV powder is ready to be consolidated into its final form.

These solvents create many environmental hazards and they are a major factor in the explosive safety hazards associated with the process. Incidents involving accidental ignition of MTV have been reported in

every stage of the manufacturing process from mixing to pressing. Results of such accidents range from loss of material and equipment to loss of life and facilities. Mixing, handling and even consolidation can generate electrostatic charges in and on the MTV pyrotechnic. Because of its low resistivity, these charges can build up to dangerously high levels, eventually producing an electrostatic spark. Highly flammable solvent-air mixtures present in and around the pyrotechnic mixture during each step of the process compound the hazard. These solvent-air mixtures require much less energy for ignition than the pyrotechnic compositions and produce flames above the materials auto ignition temperature. If the concentration of the solvent in air is within the flammability limits, then the gaseous mixture can ignite, leading to ignition of the entire pyrotechnic composition.

TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
Cyanides (as CN)	varies depending of compound	No information found.	Air sample using filter; analyze using specific ion electrode. Sampling and analytical protocol in accordance with established methodology.	OSHA; ACGIH; NIOSH: 5 mg/m ³ (Ceiling) IDLH: 50 mg/m ³	Inadequate warning properties; recommend the use of supplied air respirators. Recommended Gloves: Butyl 1.00 hr.	Boiling Pt: 2725°F; 1496°C Melting Pt: 1047°F; 564°C Solubility: 58% Flash Pt: Not available LEL/LFL: Not available UEL/UFL: Not available Vapor Density: Not available Vapor Pressure: 0 mmHg Specific Gravity: 1.6 Incompatibilities: Strong oxidizers, acids, acid salts, chlorates, and nitrates Appearance and odor: KCN and NaCN are white granular or crystalline solids with a faint almond-like odor	Overexposure may result in chemical asphyxiation and death. Symptoms of exposure include weakness, headache, confusion, nausea, vomiting, increased respiratory rate, slow gasping respirations, irritation of the eyes and skin. Target organs are listed as Cardiovascular system, Central nervous system, liver, kidneys, and skin.
PCBs							
Aroclor-1260 (Polychlorinated Biphenyl, PCB) It should be noted that this substance is representative of the more common isomers Aroclor - 1242, 1254, which may be encountered.	11096-82-5 53469-21-9 (42%) 11097-69-1 (54%)	Substance is not volatile (VP=0.00006 mmHg), I.P. is unknown however is anticipated to be elevated, therefore, PID is not anticipated to detect this substance. Substance is non combustible and as a result will not be detected by FID.	Air sample using a particulate filter, Florisil sorbent tube with glass fiber filter; hexane desorption; gas chromatography-electron capture detector. Sampling and analytical protocol shall proceed in accordance with NIOSH Method #5503 (PCBs).	OSHA; ACGIH: 0.5 mg/m ³ (skin) NIOSH: 0.001 mg/m ³ IDLH: 5 mg/m ³	Inadequate - However due to the low volatility it is assumed unless agitated this substance does not present a volatile vapor or gas respiratory threat. For dusty conditions where this material may cling to particulates, use a HEPA filter. APRs are approved for escape only when concentrations exceed the exposure limits. Concentrations greater than the exposure limits require PAPR or supplied air respirators. Recommended glove: Butyl rubber >24 hrs; Neoprene rubber >24.00 hrs; Silver shield or Viton (for pure product).	Boiling Pt: distillation range 689- 734°F; 365-390°C Melting Pt: -2 to 50°F; -19 to 10°C Solubility: Insoluble Flash Pt: Not applicable LEL/LFL: Not applicable UEL/UFL: Not applicable Nonflammable liquid, however, exposure to fire results in black soot containing PCBs, dibenzofurans, & chlorinated dibenzo-p-dioxins Vapor Density: Not available Vapor Pressure: 0.00006 - 0.001 mmHg Specific Gravity: 1.566 @ 60°F; 15.5°C Incompatibilities: Strong oxidizers Appearance and Odor: Colorless to pale yellow, viscous liquid or solid (Aroclor 54 below 50°F) with a mild, hydrocarbon odor	This substance is irritating to the eyes and skin. Chronic effects of overexposure may include potential to cause liver damage, chloracne, and reproductive effects. Recognized as possessing carcinogenic properties by NIOSH, and NTP.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
ENERGETICS							
RDX Synonym: Cyclo-1,3,5-trimethylene- 2,4,6-trinitramine; Cyclonite; Trimethylenetrini-tramine; T4; RDX	121-82-4	No information found.	Air sampling use particulate filter; gravimetric detection. Sampling and analytical procedures shall be in accordance with NIOSH Method #0500 (Nuisance Dust, Total).	OSHA/NIOSH/ACGIH: 1.5 mg/m ³ (skin); STEL 3 mg/m ³ (skin)	Sensitive to friction, as stable as TNT, explosive when heated to 260°C; 126.6°F Respiratory Protection: Can use air purifying respirator with an organic vapor cartridge for concentrations up to 75 mg/m ³ . Airborne concentrations above this level use an airline respirator or SCBA. Recommended Gloves: Impermeable gloves suitable to prevent skin contact. Nitrile gloves have been selected for most other applications.	Boiling Pt: Not available Melting Pt: Pure 399°F; 204.1°C Military grade ~10% HMX ~374°F; ~190°C Freezing Pt: Not available Solubility: Insoluble in water; soluble hot aniline, phenol, and nitric acid Specific Gravity: 1.2 Vapor Pressure: Not available Flash Pt: Heat (explosion in 5 seconds) 500°F; 260°C LEL: Not available UEL: Not available Incompatibles: Strong oxidizers, combustible materials, mercury fulminate, and heat Appearance and odor: Colorless to white crystalline powder, odorless	Routes of exposure: Inhalation, ingestion, skin and eye contact. Sign and symptoms of overexposure may include: headaches, dizziness, nausea, hyperactivity, convulsions, seizures, fatigue, irritability. These effects may be experienced quickly or several hours later. Typically irritating to skin and eyes.
Cyclotetramethylene tetranitramine Octagen, (HMX)	2691-41-0	No information found.	Air sampling use particulate filter; gravimetric detection. Sampling and analytical procedures shall be in accordance with NIOSH Method #0500 (Nuisance Dust, Total).	OSHA/NIOSH: 15 mg/m ³ total dust; 5 mg/m ³ respirable fraction. ACGIH: 10 mg/m ³ for total dust.	Respiratory Protection: Can use air purifying respirator with an organic vapor cartridge for concentrations up to 75 mg/m ³ . Airborne concentrations above this level use an airline respirator or SCBA. Recommended Gloves: Impermeable gloves suitable to prevent skin contact. Nitrile gloves have been selected for most other applications.	Boiling Pt: Not available Melting Pt: 530°F; 276.7°C Freezing Pt: Not available Solubility: Not available Specific Gravity: Not available Vapor Pressure: Not available Flash Pt: Not available LEL: Not available UEL: Not available Incompatibles: Not available Appearance: White powder	Routes of exposure: Inhalation, ingestion, and skin and eye contact. Signs and symptoms of overexposure will be similar to those specified for RDX.
MTV Magnesium Teflon Viton	7439-95-4 116-14-3 64706-80-5	No information found.	No information found.	No information found.	May explode on exposure to heat, shock, or friction. Thermal decomposition may release toxic and/or hazardous gases. Recommended Gloves: Impermeable gloves suitable to prevent skin contact. Nitrile gloves have been selected for most other applications	Boiling Pt: Not available Melting Pt: Not available Freezing Pt: Not available Solubility: Not available Specific Gravity: Not available Vapor Pressure: Not available Flash Pt: Not available LEL: Not available UEL: Not available Incompatibles: Beryllium Fluoride, Carbonates, Methanol, Sulfur & Oxidizers (strong) Appearance: Solid gray-sandy powder or extruded shaped grains	Routes of exposure: Inhalation, ingestion, and skin and eye contact. Signs and symptoms of overexposure will be malaise, weakness, numbness & tingling in arms & fingers, pain in throat and chest, dyspnea, nausea, vomiting, aching joints, asthmatic respiration & pulmonary edema with symptoms lasting 24 – 48 hours, respiratory tract damage may result. Smoking may increase risk of polymer fume fever due to tobacco contamination

TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
ENERGETICS (Continued)							
2,4,6-Trinitrotoluene (TNT) Synonyms: Trinitrotoluene (dry)	118-96-7	PID: Ionization Potential - 10.59 eV, relative response ratio is unknown. FID: Relative response ratio is unknown it is estimated that the response will be slightly less than benzene (150%) or toluene (110%).	Air sample using a Tenax GC tube; Acetone desorption; GC/TEA detection. Sample and analytical protocol in accordance with OSHA Method #44.	OSHA: 1.5 mg/m ³ (skin) ACGIH: 0.5 mg/m ³ (skin) NIOSH: 0.5 mg/m ³ (skin)	Rapid heating to 466°F; 240°C will cause detonation. Pale yellow crystals, subject to detonation by exposure to shock or temperatures exceeding 466°F; 240°C. Air purifying respirators recommended for escape purposes only. Recommended Gloves: Any glove which is impermeable to contact.	Boiling Pt: 466°F; 240°C Melting Pt: 176°F; 80°C Detonation Pt: 464°F; 240°C Solubility: 0.01% at 75°F; 25°C Specific Gravity: 1.65 Vapor Density: 7.8 Vapor Pressure: 0.057 mmHg @ 178°F; 81°C Flash Pt: Explodes 842°F; 450°C LEL: Not available UEL: Not available Incompatibles: Strong oxidizers, ammonia, combustible materials, and heat. Appearance and odor: Colorless to light yellow solid or crushed flakes.	Routes of Exposure: inhalation, absorption, ingestion, and skin & eye contact. The following symptoms may be experienced: Sneezing, coughing, sore throat, muscle pain, peripheral nerve sensitization, and irritation of the skin and mucous membranes. Chronic exposure may cause liver damage, jaundice, cyanosis, kidney damage, anemia, cataract, leukocytosis.
Titanium Tetrachloride	7550-45-0	No information found	No information found	None available	Fuming liquid with a irritating odor. May react on contact with air, hear, light, or water. Recommended Air Purifying cartridges: Organic vapor	Boiling Pt: 277°F; 136°C Melting Pt: -11.38°F; -24.1°C Solubility: Violent reaction Flash Pt: not flammable LEL/LFL: Nonflammable UEL/UFL: Nonflammable Vapor Density: 6.6 Vapor Pressure: 23 mmHg @ 100.4°F; 38°C Specific Gravity: 1.726 Incompatibilities: water, potassium metal, chemically active metals, ammonia, alcohols Appearance and odor: Colorless to light yellow liquid that has a penetrating acid odor.	Highly irritating to skin, eyes, and mucous membranes. Exposure may result in surface skin burns and marked congestion and constriction of upper respiratory tract. May damage the cornea.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
ENERGETICS (Continued)							
Vanadium Oxytrichloride	7727-18-6	No information found	No information found	None available	Emits red fumes upon contact with air. Sharp irritating and unpleasant odor. Sinks in water and reacts violently with water to form toxic hydrochloric acid. Vapors are heavier than air and will collect and stay in low areas	Boiling Pt: 260.6°F; 127°C Melting Pt: not available Solubility: not available Flash Pt: not flammable LEL/LFL: Nonflammable UEL/UFL: Nonflammable Vapor Density: not available Vapor Pressure: 13.8 mmHg @ 68°F; 20°C Specific Gravity: 1.84 Incompatibilities: acids, water, amines, bases. Appearance and odor: Colorless to light yellow liquid that has a penetrating acid odor.	May be harmful by inhalation, ingestion and skin absorption. Causes eye and skin burns. Extremely destructive to mucous membranes, respiratory tract, eyes and skin. Inhalation may be fatal. Symptoms include burning sensation, coughing, wheezing, laryngitis, shortness of breath, headache, nausea, and vomiting. Can cause damage to liver and kidneys.
VOLATILE ORGANIC COMPOUNDS (VOCs)							
Trichloroethylene	79-01-6	PID: I.P. 9.45 eV, High response with PID and 10.2 eV lamp. FID: 70% Response with FID.	Air sample using charcoal tube; carbon disulfide desorption; Sampling and analytical protocol shall proceed in accordance with OSHA Method #07, or NIOSH Method #1022 or #1003.	OSHA: 50 ppm; 200 ppm (Ceiling) ACGIH: 50 ppm; 100 ppm STEL NIOSH: 25 ppm IDLH: 1000 ppm	Inadequate - Odor threshold 82 ppm. APRs with organic vapor/acid gas cartridges may be used for escape purposes. Exceedances over the exposure limits require the use of positive pressure-demand supplied air respirator. Recommended gloves: PV Alcohol unsupported >16.00 hrs; Silver shield >6.00 hrs; Teflon >24.00 hrs; or Viton >24.00 hrs; Nitrile (Useable time limit 0.5 hr, complete submersion for the nitrile selection)	Boiling Pt: 188°F; 86.7°C Melting Pt: -99°F; -73°C Solubility: 0.1% @ 77°F; 25°C Flash Pt: 90°F; 32°C LEL/LFL: 8% @ 77°F; 25°C UEL/UFL: 10.5 @ 77°F; 25°C Vapor Density: 4.53 Vapor Pressure: 100 mmHg @ 90°F; 32°C Specific Gravity: 1.46 Incompatibilities: Strong caustics and alkalis, chemically active metals (barium, lithium, sodium, magnesium, titanium, and beryllium) Appearance and Odor: Colorless liquid with a chloroform type odor. Combustible liquid, however, burns with difficulty.	Central nervous system effects including euphoria, analgesia, anesthesia, paresthesia, headaches, tremors, vertigo, and somnolence. Damage to the liver, kidneys, heart, lungs, and skin have also been reported. Contact may result in irritation to the eyes, skin, and mucous membranes. Ingestion may result in GI disturbances including nausea, and vomiting. NIOSH lists this substance a potential human carcinogen.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
VOLATILE ORGANIC COMPOUNDS (Continued)							
Toluene	108-88-3	PID: I.P 8.82 eV, High response with PID and 10.2 eV lamp. FID: 110% response with FID.	Air sample using charcoal tube; carbon disulfide desorption. Sampling and analytical protocol shall proceed in accordance with OSHA Method #07, or NIOSH Method #1500.	OSHA: 200 ppm 300 ppm (Ceiling) ACGIH: 50 ppm (skin) NIOSH: 100 ppm 150 ppm STEL IDLH: 500 ppm	Adequate - Odor threshold 1.6 ppm is considered good. Can use air-purifying respirator with organic vapor cartridge up to 1,000 ppm. Recommended gloves: Teflon >15.00 hrs; Viton >16.00 hrs; silver shield >6.00 hrs; supported nitrile (Useable time limit 0.5 hr, complete submersion for the nitrile selection); PV alcohol >25.00 hrs	Boiling Pt: 232°F; 111°C Melting Pt: -139°F; -95°C Solubility: 0.05% (61°F;16°C) Flash Pt: 40°F; 4°C LEL/LFL: 1.2% UEL/UFL: 7.1% Vapor Density: 3.14 Vapor Pressure: 20 mmHg @ 65°F; 18°C Specific Gravity: 0.87 Incompatibilities: Strong oxidizers Appearance and odor: Colorless liquid with a sweet pungent aromatic odor.	Overexposure to this substance may result in mild to moderate irritation at all points of contact, and CNS changes including euphoria, confusion, nervousness, and possibly paresthesia characterized by an abnormal burning sensation, pricking, or numbness. At 200-500 ppm exposure has resulted in headaches, nausea, eye irritation, loss of appetite, bad taste, impair coordination, fatigue, and weariness. Chronically, toluene overexposure may result in dermatitis, liver, and kidney damage.
Methyl ethyl ketone (2-Butanone)	78-93-3	PID: I.P. 9.54 eV, high response with PID and 10.2 eV lamp. FID: 80% relative response ratio with FID.	Air sample using Ambersorb tube; carbon disulfide desorption; GC/FID detection. Sampling and analytical protocol shall proceed in accordance with OSHA Method #16, 84 or NIOSH Method #2500.	OSHA; NIOSH; ACGIH: 200 ppm NIOSH; ACGIH: have established STEL of 300 ppm IDLH: 3000 PPM	Adequate - Can use air purifying respirator with organic vapor cartridges up to 2000 ppm. Recommended glove: Poly vinyl alcohol or natural rubber	Boiling Pt: 175°F; 79°C Melting Pt: -124°F; -86.4°C Solubility: 28% Flash Pt: 16°F; 9°C LEL/LFL: 1.4% UEL/UFL: 11.4% Vapor Density: 2.41 Vapor Pressure: 71 mmHg Specific Gravity: 0.81 Incompatibilities: Strong oxidizers, amines, ammonia, inorganic acids, caustics, copper, isocyanates, pyridines Appearance and odor: Colorless liquid with a moderately sharp, fragrant mint- or acetone like odor	Exposure may result in irritation to the eyes and nose. Overexposure may cause headache, dizziness, and vomiting. Target organs are the Central Nervous System and lungs.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
SEMI VOLATILE ORGANIC COMPOUNDS (SVOCs)							
Diesel Fuel No.2-D	Mixture	Components of this substance will be detected readily however no documentation exists as to the relative response ratio of either PID or FID.	Air sample using charcoal tube as a collection media; carbon disulfide desorption; GC/FID detection. Sampling and analytical protocol in accordance with NIOSH Method #1550.	OSHA; NIOSH; ACGIH: 5 mg/m ³ as mineral oil mist. In addition NIOSH and ACGIH establish 10 mg/m ³ as a STEL.	Kerosene odor Recommended Air Purifying cartridges: Organic vapor Recommended gloves: Nitrile	Boiling Pt: <170-400°F; 77-204°C Melting Pt: Not available Solubility: Negligible Flash Pt: 125°F; 52°C LEL/LFL: 0.6% UEL/UFL: 7.5% Vapor Density: >5 Vapor Pressure: <1 mmHg @ 70°F; 21°C Specific Gravity: 0.86 Incompatibilities: strong oxidizers, halogens, and hypochlorites Appearance and odor: Colorless to amber with a kerosene odor	Prolonged or repeated exposures to this product may cause skin and eye irritation. Due to the defatting capabilities this exposure may lead to a dermatitis condition. High vapor concentrations are irritating to the eyes and respiratory tract. Exposure to high airborne concentrations may result in narcotic effects including dizziness, headaches, and anesthetic to unconsciousness. High concentrations in a confined space may adequately displace oxygen thereby resulting in suffocation.
Naphtha (coal tar)	8030-30-6	Components of this substance will be detected readily however no documentation exists as to the relative response ratio of either PID or FID.	Air sample using charcoal tube as a collection media; carbon disulfide desorption; GC/FID detection. Sampling and analytical protocol in accordance with NIOSH Method #1550.	OSHA; NIOSH 100 ppm IDLH 1000 ppm	Extremely flammable Recommended Air Purifying cartridges: Organic vapor Recommended gloves: Nitrile	Boiling Pt: 320-428°F; °C Melting Pt: Not available Solubility: Insoluble Flash Pt: 100-109°F; °C LEL/LFL: 1% UEL/UFL: ? Vapor Density: <5mm Vapor Pressure: <1 mmHg @ 70°F; 21°C Specific Gravity: 0.89 – 0.97 Incompatibilities: strong oxidizers, Appearance and odor: Reddish-brown with an aromatic odor	Prolonged/repeated contact with skin may cause redness, irritation, burning, drying or cracking. Will cause redness, burning, tearing or swelling in the eyes. Irritation will also occur. The primary routes of exposure are inhalation contact to eyes and skin. The target organs are the eyes, skin and respiratory system. May cause irritation or injury to membranes of the mouth, throat and gastrointestinal tract. Vomiting and cramps may occur.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
METALS							
Aluminum	7429-90-5	Particulate form - unable to be detected by PID/FID.	Air sample using a cellulose ester membrane filter (particulate filter); atomic absorption (Method #7013) or ICP (Method #7300). Sampling and analytical protocol shall proceed in accordance with NIOSH Methods #7013 and #7300 as applicable.	OSHA: 15 mg/m ³ Total dust, 5 mg/m ³ Respirable fraction NIOSH: 10 mg/m ³ Total dust, 5 mg/m ³ Respirable fraction ACGIH: 10 mg/m ³	Particulate form - No identifiable warning properties to indicate presence and thereby detection. Employ air purifying respiratory protection suitable for dust and fume. Organic vapor acid gases with HEPA filter. Recommended gloves: this is in the particulate form. Therefore any glove suitable to prevent skin contact (Nitrile has been the one most widely used for the other substances).	Boiling Pt: 4452°F; 2450°C Melting Pt: 1220°F; 660°C Solubility: Insoluble Flash Pt: Nonflammable LEL/LFL: Nonflammable UEL/UFL: Nonflammable It should be noted that finely divided powders or dust when airborne becomes moderately flammable/explosive when exposed to heat, flame, or powerful oxidizers Vapor Density: Not available Vapor Pressure: 1 mm @ 2343°F; 1284°C Specific Gravity: 2.702 @ 77°F; 25°C Incompatibles: Acids, alkalis, oxidizers, halogens and halocarbons, alcohols Appearance and odor: silvery gray ductile, lustrous metal	Inhalation of finely divided powders or dusts may result in difficulty in breathing, coughing, and has been reported to cause pulmonary fibrosis. This malady known as "Shavers disease" is a form of benign pneumoconiosis.
Cadmium	7440-43-9	Particulate Form - Unable to be easily detected by PID or FID.	Air sample using a mixed cellulose-ester filter / acid desorption and analysis by atomic absorption-flame. Sampling and analytical protocol shall proceed in accordance with NIOSH Method #7300 or #7048.	OSHA: 2 µg/m ³ (0.002 mg/m ³) ACGIH: 0.01 mg/m ³ (total particulate); 0.002 mg/m ³ (respirable particulate) IDLH: 9 mg/m ³ (as cd)	The use of an air purifying, full face-piece respirator with a high efficiency particulate air filter for concentrations up to 0.25 mg/m ³ . Recommended Gloves: This is in particulate form. Therefore any glove suitable to prevent skin contact.	Boiling Pt: 1412°F; 767°C Melting Pt: 610°F; 321°C Solubility: Insoluble Flash Pt: Not applicable (Airborne dust may burn or explode when exposed to heat, flame, or incompatible chemicals) LEL/LFL: Not applicable UEL/UFL: Not applicable Vapor Density: Not available Vapor Pressure: 1 mmHg @ 741°F; 394°C Specific Gravity: 8.65 @ 90°F; 32°C Incompatibilities: Strong oxidizers, elemental sulfur, selenium, tellurium, zinc, nitric acid, and hydrazoic acid Appearance and Odor: Metal: Silver-white, blue-tinged lustrous, odorless solid. Fume: yellow-brown, finely divided particulate dispersed in air.	Overexposure to this substance may result in irritation to the respiratory tract, dyspnea, tightness in the chest, coughing, possibly pulmonary edema. Overexposure to fumes causes symptoms characteristic of the flu (headaches, chills, muscle aches, nausea, vomiting, diarrhea). Chronic exposure may result in damage to the lungs, kidneys and liver. This substance has been identified as a confirmed animal; potential human carcinogen by IARC and NTP.

TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA

Substance	CAS No.	Air Monitoring/Sampling Information		Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information
METALS (continued)							
Chromium Compounds	7440-47-3 (Element)	Not detectable by PID. Not detectable by FID.	Air sample using mixed cellulose-ester filter; acid desorption and analysis by atomic absorption. Sampling and analytical protocol shall proceed in accordance with NIOSH Method #7024.	OSHA & NIOSH: (Chromium II, III) 0.5 mg/m ³ (Chromium VI) 0.1 mg/m ³ (Ceiling) ACGIH: 0.5 mg/m ³ (Chromium II, III compounds), 0.05 mg/m ³ (Chromium VI compounds) IDLH: 30 mg/m ³ (Chromium VI compounds)	The use of a air purifying, full face-piece respirator with a high efficiency particulate filter for concentrations up to 0.1 mg/m ³ . Recommended Gloves: This is in particulate form. Therefore any glove suitable to prevent skin contact.	Boiling Pt: 4788°F; 2642°C Melting Pt: 3452°F; 1900°C Solubility: Insoluble Flash Pt: Not applicable (Airborne dust may burn or explode when exposed to heat, flame, or incompatible chemicals) LEL/LFL: Not applicable UEL/UFL: Not applicable Vapor Density: Not available Vapor Pressure: 0 mmHg Specific Gravity: 7.14 Incompatibilities: Strong oxidizers, peroxides, and alkalis Appearance and Odor: Appearance and odor vary depending upon the specific compound.	Health hazards are characterized normally through chronic exposure manifesting as histologic fibrosis of the lungs and ulceration of the nasal septum and skin. IARC, NTP and ACGIH list various chromium compounds as possessing carcinogenic properties.
Lead	7439-92-1	Particulate form - Unable to be detected by either PID or FID.	Air sample using a mixed cellulose ester filter; or HNO ₃ or H ₂ O ₂ desorption; or Atomic absorption detection. Sampling and analytical protocol shall proceed in accordance with NIOSH Method #7082 or #7300.	OSHA: 0.05 mg/m ³ ACGIH: 0.15 mg/m ³ NIOSH: 0.10 mg/m ³ IDLH: 100 mg/m ³ as lead	The use of a air purifying, full-face respirator with high efficiency particulate air filter for up to 2.5 mg/m ³ . Recommended gloves: This is in the particulate form. Therefore any glove suitable to prevent skin contact (Nitrile has been the one most widely used for the other substances).	Boiling Pt: 3164°F; 1740°C Melting Pt: 621°F; 327°C Solubility: Insoluble Flash Pt: Not applicable (Airborne dust may burn or explode when exposed to heat, flame, or incompatible chemicals) LEL/LFL: Not applicable UEL/UFL: Not applicable Vapor Density: Not available Vapor Pressure: 0 mmHg Specific Gravity: 11.34 Incompatibilities: Strong oxidizers, peroxides, sodium acetylide, zirconium, and acids Appearance and Odor: Metal: A heavy ductile, soft gray solid.	Overexposure to this substance via ingestion or inhalation may result in metallic taste in the mouth, dry throat, thirst, Gastrointestinal disorders (burning stomach pain, nausea, vomiting, possible diarrhea sometimes bloody or black, accompanied by severe bouts of colic), CNS effects (muscular weakness, pain, cramps, headaches, insomnia, depression, partial paralysis possibly coma and death. Extended exposure may result in damage to the kidneys, gingival lead line, brain, and anemia.

**TABLE 6-1
CHEMICAL, PHYSICAL, AND TOXICOLOGICAL DATA
NAVAL SURFACE WARFARE CENTER CRANE DIVISION
CRANE, INDIANA**

Substance	CAS No.	Air Monitoring/Sampling Information	Exposure Limits	Warning Property Rating	Physical Properties	Health Hazard Information	
METALS (continued)							
Mercury	7439-97-6	Jerome Mercury Vapor Analyzer This substance is unable to be detected by PID/FID.	Air sample using Hydrar® sorbent tube; acid desorption; AA cold detection. Sampling and analytical protocol shall proceed in accordance with NIOSH Method #6009.	OSHA; NIOSH; ACGIH: as alkyl compounds 0.01 mg/m ³ ; STEL 0.03 mg/m ³ IDLH: 10 mg/m ³	No identifiable warning properties to indicate presence and thereby detection. Recommended APR Cartridge: Suitable for Metallic mercury with HEPA filter. Preferably, with an end-of-service life indicator. Recommended gloves: Rubber gloves	Boiling Pt: 674°F; 356.9°C Melting Pt: -38°F; -38.89°C Solubility: Insoluble Flash Pt: Not available LEL/LFL: Not available UEL/UFL: Not available Vapor Density: Not available Vapor Pressure: 0.0012 mmHg @ 77°F; 25°C Specific Gravity: 13.6 Incompatibilities: Acetylene, ammonia, chlorine dioxide, azides, calcium, sodium carbide, lithium, rubidium, and copper Appearance and odor: Silvery-white heavy mobile liquid, odorless	This substance is corrosive to all points of contact. Systemic symptoms include irritability, wakefulness, muscle weakness and tremors, increased reflexes, gingivitis, anorexia, headache, tinnitus, hypermobility, GI disturbances (nausea, vomiting), diarrhea (sometimes bloody), liver changes, dermatitis, and fever. Symptoms experienced via inhalation include to those above coughing, chest pain, dyspnea, bronchial pneumonitis, and excessive salivation.
Zinc	7440-66-6	Particulate form - This substance is not detectable using a PID or FID.	Air sample using a particulate filter; acid desorption; AAS detection. Sampling and analytical protocol will proceed in accordance with NIOSH Method #7300.	OSHA: 10 mg/m ³ Total dust, 5 mg/m ³ Respirable fraction NIOSH: 5 mg/m ³ , 15 mg/m ³ (Ceiling) ACGIH: 10 mg/m ³	No identifiable warning properties to indicate presence and thereby detection. Recommended APR Cartridge: Suitable for dust and fume. Organic vapor acid gases with HEPA filter. Recommended gloves: This is in the particulate form. Therefore any glove suitable to prevent skin contact (Nitrile has been the one most widely used for the other substances).	Boiling Pt: 1666°F; 908°C Melting Pt: 788°F; 419.8°C Solubility: Insoluble Flash Pt: Not available (Airborne dust may burn or explode when exposed to heat, flame, or incompatible chemicals) LEL/LFL: Not available UEL/UFL: Not available Vapor Density: Not available Vapor Pressure: 0 mmHg Specific Gravity: 7.14 Incompatibilities: Strong acids, halogens, catalytic metals, combustibles, oxidizers, nitryl fluoride Appearance and odor: Bluish-white, lustrous metal, odorless	Inhalation of fumes may result in metal fume fever. This condition is characterized by metallic taste, dryness of the throat, coughing with generalized aching and flu-like symptoms. Effects through ingestion may include coughing, difficulty in breathing, and sweating. A human skin irritant. Irritation to the eyes may result from mechanical action.

6.2 PHYSICAL HAZARDS

The following is a list of physical hazards that may be encountered at the site or may be present during the performance of site activities associated with the scope of work. Some of these hazards are discussed below while the rest are discussed in the TtNUS Health and Safety Guidance Manual.

- Slips, trips, and falls
- Cuts (or other injuries associated with hand tool use)
- Energized systems (contact with underground or overhead utilities)
- Lifting (strain/muscle pulls)
- Ambient temperature extremes (cold and heat stress)
- Pinches and compressions
- Heavy equipment hazards (rotating equipment, hydraulic lines, etc.)
- Vehicular and foot traffic
- Noise in excess of 85 dBA

6.2.1 Slips, Trips, And Falls

Conditions such as steep terrain and/or heavy vegetation may create an increased potential for slip, trip, and fall hazards

- The safest approach to sample points will be identified and cleared to permit field crew access to sample locations.
- Establish anchor points and rope handrails for traversing/ascending/descending angles and slopes greater than 45% grade.
- Footwear with an adequate traction.
- Prepare work areas by removing tripping hazards (ruts, roots, debris). This is especially critical around rotating equipment, where a fall into the rotating apparatus could be life threatening.

6.2.2 Cuts or Other Injuries Associated with Hand Tool Use

The control measures presented below will help minimize the potential for physical and cutting hazards.

- Wear leather or heavy cotton work gloves when using tools to protect against blisters, cuts, or other hand injuries.
- Wear eye protection (safety glasses with side shields) to protect the eyes from flying debris.
- Wear long pants and long-sleeved shirts to protect against abrasions.

- Inspect all hand tools before each use.
- Ensure all knives are sharp to facilitate cutting action. This will avoid persons forcing to cut and increasing potential hazards.
- Use the proper tool for the intended purpose. The proper tool for cutting the acetate tube for sampling is the retention tub recommended by Geoprobe. This will avoid potential injury possibly created through improper cutting procedures.

6.2.3 Energized Systems (Contact with Underground or Overhead Utilities)

Underground utilities such as pressurized lines, water, telephone, buried utility, and high voltage power lines may be present throughout the facility. NSWCrane has digging permits that must be obtained prior to any intrusive work. Therefore, all subsurface activities must be conducted following the requirements of the NSWCrane Permit System. The Tetra Tech NUS SOP for "Utility Locating and Excavation Clearance (HS-1.0)" is included as a backup to the NSWCrane policies. A copy of this SOP is provided as Attachment IV. Clearance of underground and overhead utilities for each location will be coordinated with the Site Contact. Additionally, DPT operations will be conducted at a safe distance from overhead power lines. In certain cases, there may be a need to de-energize electrical cables using facility lockout/tagout procedures to insure electrical hazards are eliminated.

6.3 NATURAL HAZARDS

Insect/animal bites and stings, poisonous plants, and inclement weather are natural hazards that may be present given the location of activities to be conducted. As previously discussed, some portions of the site include vegetated areas which increases the potential for field crews to encounter ticks, bees, mosquitoes/insects, snakes, and poisonous vegetation.

6.3.1 Insect Bites and Stings

Insect/animal bites and stings are difficult to control given the climate and environmental setting of NSWCrane. However, in an effort to minimize this hazard the following control measures will be implemented where possible.

- Commercially available bug sprays and repellents will be used whenever possible – Pesticides analytical screening includes chlordane, endrin, lindane, methoxychlor, toxaphene and heptachlor. Commercially available repellants may be used providing they don't contain substances which appear on the analytical list for pesticide analysis. Products such as DEET should not be applied directly to the skin due to potential irritation. This product, when permitted for use, should be applied over clothing articles.

- Where possible, loose-fitting and light-colored clothing with long sleeves should be worn. This will also aid in insect control by providing a barrier between the field person and the insects and to provide easy recognition of crawling insects against the lighter background. Pant legs should be secured to the work-boots using duct tape to prevent access by ticks.
- Clothing/limited body checks for ticks and other crawling insects should be conducted upon exiting heavily vegetated areas. Workers should perform a more detailed check of themselves when showering in the evening. Ticks prefer moist areas of the body (arm-pits, genitals, etc.) and will migrate to those locations.
- The FOL/SSO will preview access routes and work areas in an effort to identify physical hazards including nesting areas in and around the work sites. These areas will be flagged and communicated to site personnel.
- The FOL/SSO must determine if site personnel (through completion of Medical Data Sheets), suffer allergic reactions to bee and other insect stings and bites. Field crewmembers that are allergic to bites should have their emergency kit containing antihistamine and a preloaded syringe of epinephrine readily available.

Any allergies (insect bites, bee stings, etc.) must be reported on the Medical Data Sheet and to the SSO.

Tick and Mosquito Transmitted Illnesses and Diseases

Ticks and mosquitoes have been identified in the transmission of diseases including Lyme's disease and malaria. Warm months (Spring through early Fall) are the most predominant time for this hazard. Information concerning Lyme's disease including recognition, evaluation, tick removal, and control is provided in Section 4.0 of the Health and Safety Guidance Manual.

Malaria may occur when a mosquito or other infected insect sucks blood from an infected person, and the insect becomes the carrier to infect other hosts. The parasite reproduces within the mosquito, and is then passed on to another person through the biting action. Acute symptoms include chills accompanied by fever and general flu like symptoms. This generally terminates in a sweating stage. These symptoms may recur every 48 to 72 hours.

The Indiana State Department of Health has been monitoring the arrival of WNV in the state. Crows found in Marion and Floyd Counties are the first positive indicator that West Nile virus has officially arrived in Indiana. State health officials say that although this is the first time West Nile encephalitis virus, which

is transmitted by mosquitoes, has been identified in the state, it is not unexpected. No human cases have been found in Indiana. West Nile Encephalitis cases occur primarily in the late summer or early fall.

Mild infections are common and include fever, headache, and body aches, often with skin rash and swollen lymph glands. More severe infection is marked by headache, high fever, neck stiffness, stupor, disorientation, coma, tremors, occasional convulsions, paralysis and, rarely, and death (especially in the elderly and very young). The incubation period of West Nile encephalitis is usually 3 to 12 days. There is no specific therapy or vaccine against West Nile encephalitis.

Precautions include:

- Limit outdoor activities during peak mosquito times – at dusk and dawn.
- Avoid standing water
- Wear long-sleeved shirts and long pants whenever you are outdoors.
- Apply insect repellent according to manufacturers instruction to exposed skin. An effective repellent will contain 20% to 30% DEET (N,N-diethyl-meta-toluamide). Avoid products containing more than 30% DEET.
- Spray clothing with repellents containing permethrin or DEET, mosquitoes may bite through thin clothing.

6.3.2 Snakes and Other Wild Animals

Indigenous animals including snakes (poisonous and non-poisonous varieties), raccoons, and other animals native to the region may be present at the site. These animals may be encountered if work locations encroach on nesting or territories claimed by these animals.

To avoid the obvious hazards conveyed as part of a direct encounter, the following actions will be taken to minimize impact on the field crews and/or operations. The FOL/SSO will preview access routes and work locations for nesting areas or signs of animal activities (tracks, foraging areas, etc.). Identified suspect areas will be communicated to the field crews. Snake chaps will be required as a precaution.

Venomous Snakes of Indiana

There are few poisonous snakes in Indiana. Indiana's poisonous snakes are all very heavy-bodied – they look “fat.” They also have broad, spade-shaped heads that are distinctly wider than their narrow necks. The heads of non-venomous snakes are typically about the same width as their bodies. Such distinctions are not completely reliable, as some species such as water snakes can be rather stout, and many species of snakes will flatten their heads when bluffing, giving the head a spade-like shape as well. The pupils of

the venomous snakes of Indiana are vertical slits rather than round. This distinction may not hold elsewhere, but works in this state.

Do not attempt to handle or kill a snake that you believe may be venomous. Simply keep at a safe distance and move on your way. Snakes do not actively seek out people and bite them. Given the chance, snakes will almost always try to escape an encounter. If you leave them alone, they will make every effort to leave you alone as well. Be very careful to avoid the head when handling dead snakes. A snake's reflexes can remain functional hours after death, and supposedly "dead" snakes have bitten people.

Copperhead - The most common venomous species is the copperhead, and even it has a restricted range in the hills of southern Indiana.

Appearance: The copperhead is a moderately large snake that typically measures 24 to 36 inches in length. Its head is reddish-brown in color and its body is tan. The body is marked with 15 to 19 mahogany lateral bands with darker edges that are wide on the sides and narrow on the back. The lateral bands are occasionally interrupted along the midline. Viewed from above, these bands appear hourglass shaped. Irregular brown spots are often found between the bands. The copperhead has a wedge-shaped head, sensory pits, and vertically elliptical "cat-like" pupils. The young are pale with a yellow tipped tail and are 8 to 9 inches in length.

Ecology: The copperhead is found primarily in high, dry, rocky and well-forested areas dominated by oaks and hickories. This species is very secretive and does not tolerate human presence. The copperhead is active at night the warmest part of the year and is more likely to defend itself during the evening hours. It can be found resting under logs, in cracks of foundations, and under rocks. Small rodents such as mice are its primary prey, but it also eats large moth larvae and lizards.

Timber Rattlesnakes - Timber rattlesnakes are rare and usually restricted to some of the forested hills in south central Indiana.

Appearance: These snakes are Indiana's largest, averaging 48 to 72 inches in length with a rattle on the end of their tail. They can be found in the hill country of south central Indiana. The timber rattlesnake is a thick-bodied snake with a wide head distinct from the neck, typical of our venomous snakes. The color pattern of the timber rattler is very variable, ranging from sulfur yellow and buff brown, to dark gray. Regardless of the pattern, a series of wide black cross bands line the back along the length of the body. These cross bands have been described as "blunt chevrons." Its distinctly wedge-shaped head, sensory pit, and elliptical eye slits are characteristic of all snakes in the viper family.

Ecology: The timber rattlesnake is native to heavily forested areas in the hills of southern Indiana. It feeds on small mammals and birds. The timber rattler hibernates inside the cracks and crevices of rocky hillsides. Timber rattlesnakes do not stalk their prey, but rather remain motionless and wait for their prey to move within striking distance. Populations of timber rattlesnakes are mostly limited to areas fairly isolated from human development.

Snake Bites

Initial efforts will be directed to avoid, where possible, nesting and territorial areas. However, should field personnel come in contact with these animals and receive a bite, the following actions are necessary.

- Obtain a detailed description of the snake. This and the bite mark will enable medical personnel administering medical aid to provide prompt and correct antidotes, as necessary.
- Immobilize the bite victim to the extent possible. Physical exertion will mobilize the toxins (if poisonous varieties) from the bite point systemically through the body.
- Apply a pressure wrap (for extremities), just above and over the bite area. With a couple wraps of the pressure wrap in place over the bite area, apply a splint, and continue the application of the pressure wrap. The purpose for the splint is to restrict the movement of the extremity, this along with the pressure wrap will aid in restricting the toxins from leaving the site of the bite.
- Seek medical attention immediately.

6.3.3 Poisonous Plants

Various plants which can cause allergic reactions may be encountered during field work. These include, poison ivy, poison oak, and poison sumac. Contact with these plants may occur when clearing vegetation for access to work areas, or as a result of movement through these plants. An irritating, allergic reaction can occur after direct contact with the plant or indirect contact through some piece of equipment or clothing article. Oils are transferred from the plant to exposed skin, clothing, or piece of equipment. The degree of the irritating, allergic reaction can vary significantly from one person to the next.

Protective measures to control and minimize the effects of this hazard may include, but not be limited to, the following:

- Identify plants for field personnel.

- Poison Ivy - Characterized by climbing vines, three leaf configuration ovate to elliptical in shape, deep green leaves with a reddish tint, greenish flowers, and white berries.
 - Poison Sumac - Characterized as a tall bush of the sumac family bearing compound leaves (7-13 entire leaflets), branched from a central axis, drooping, with axillary clusters of white fruit: However, these white fruits and berries may exist only during pubescent stages.
 - Poison oak - Characterized as similar to poison ivy consisting of a shrub, stems erect, 0.3 to 2.0 meters tall, leaflets consist of broad thick lobes coarsely serrated configuration, denser at the base, less so than the top.
- Protective measures may include wearing disposable garments such as Tyvek when clearing brush. These may be carefully removed and disposed of along with any oils accumulated from the plants.
 - Personal Hygiene - The oils obtained from the plants will only elicit an allergic response when the person's bare skin layer is contacted. This can be aggravated when skin pores are open (perspiring), or through breaks in the skin such as cuts, nicks, scratches, etc. This can also be accomplished when using excessively hot water for cleaning the skin, which also causes pores to open. Prior to break time, lunchtime, etc. personnel should wash with cool water and soap to remove as much of the oils as possible. In heavily vegetated areas of these plants, additional measures including barrier creams and blocks may be used to prevent the oils from accessing and penetrating the skin.

These plants present an airborne sensitization hazard when burned. This is not to occur as part of this scope of work and therefore will not be addressed.

6.3.4 Inclement Weather

Project tasks under this Scope of Work will be performed outdoors. As a result, inclement weather may be encountered. In the event that adverse weather conditions arise (electrical storms, tornados, hailstorms, etc.), the FOL and/or the SSO will be responsible for temporarily suspending or terminating activities until hazardous conditions no longer exist.

7.0 AIR MONITORING

Direct reading instruments will be used at the site to evaluate the presence of contaminants and other potentially hazardous conditions. Air monitoring measurements and requirements are established in Table 5-1 pertaining to the specific task and operations. Additionally, the Health and Safety Guidance Manual, Section 1.0, contains detailed information regarding direct reading instrumentation, as well as general calibration procedures of various instruments.

7.1 INSTRUMENTS AND USE

Instruments will be used primarily to monitor source points and worker breathing zone areas, while observing instrument action levels. Action levels are discussed in Table 5-1 as they may apply to a specific task or location.

7.1.1 Photoionization Detector or Flame Ionization Detector

In order to accurately monitor for any substances that may present an exposure potential, a Photoionization Detector (PID) using a lamp energy of 10.6 eV or higher will be used. This instrument will be used to monitor potential source areas (boreholes, monitoring wells, etc.) and to screen the breathing zones of employees during site activities. The PID has been selected because it is capable of detecting potential organic vapors of concern (NOTE: A Flame Ionization Detector [FID] may be used as an alternative to the PID).

Prior to the commencement of any field activities, the background levels of the site must be determined and noted. Daily background readings will be taken away from any areas of potential contamination. These readings, any influencing conditions (i.e., weather, temperature, humidity) and site location must be documented in the field operations logbook or other site documentation (e.g., sample log sheet).

7.1.2 Hazard Monitoring Frequency

Table 5-1 presents the frequencies that hazard monitoring will be performed as well as the action levels which will initiate the use of elevated levels of protection. The SSO may decide to increase these frequencies based on instrument responses and site observations. The frequency at which monitoring is performed will not be reduced without the prior consent of the PHSO or HSM.

7.2 INSTRUMENT MAINTENANCE AND CALIBRATION

Hazard monitoring instruments will be maintained and pre-field calibrated by the TtNUS Equipment Manager. Operational checks and field calibration will be performed on the instruments each day prior to their use. Field calibration will be performed on instruments according to manufacturer's

recommendations (for example, the PID must be field calibrated daily and an additional field calibration must be performed at the end of each day to determine any significant instrument drift). These operational checks and calibration efforts will be performed in a manner that complies with the employees health and safety training, the manufacturer's recommendations, and with the applicable manufacturer standard operating procedure (copies of which can be found in the Health & Safety Guidance Manual which will be maintained on site for reference). Calibration efforts must be documented. Figure 7-1 is provided for documenting these calibration efforts. This information may instead be recorded in a field operations logbook, provided that the information specified in Figure 7-1 is recorded. This required information includes the following:

- Date calibration was performed
- Individual calibrating the instrument
- Instrument name, model, and serial number
- Any relevant instrument settings and resultant readings (before and after) calibration
- Identification of the calibration standard (lot no., source concentration, supplier)
- Any relevant comments or remarks

8.0 TRAINING/MEDICAL SURVEILLANCE REQUIREMENTS

8.1 INTRODUCTORY/REFRESHER/SUPERVISORY TRAINING

8.1.1 Requirements for TtNUS Personnel

TtNUS personnel must complete 40 hours of introductory hazardous waste site training in accordance with 29 CFR 1910.120(e) prior to performing work at NSWC Crane. Additionally, TtNUS personnel who have had introductory training more than 12 months prior to site work must have completed 8 hours of refresher training within the past 12 months before being cleared for site work. 8-hour Supervisory Training in accordance with 29 CFR 1910.120(e)(4) will be required for site supervisory personnel.

Documentation of TtNUS Health and Safety Training will be maintained at the project site. Copies of certificates or other official documentation will be used to fulfill this requirement.

At the request of the U.S. Navy, prior to initiation of field work the SSO and FOL will meet with the Navy Point of Contact and other NSWC Crane Emergency Staff to review planned operations. TtNUS will also conduct brief daily meetings to discuss operations planned for that day. At the end of the workday, a short meeting will be held to discuss the operations completed and any problems that were encountered.

8.1.2 Requirements for Subcontractors

TtNUS subcontractor drilling personnel must have completed introductory hazardous waste site training or equivalent work experience as defined in OSHA Standard 29 CFR 1910.120(e) and 8 hours of refresher training meeting the requirements of 29 CFR 1910.120(e)(8) prior to performing field work at NSWC Crane. Surveyors are only required to have the OSHA HAZWOPER training when they could possibly be exposed to hazardous chemicals. TtNUS subcontractors must certify that each employee has had such training by sending TtNUS a letter, on company letterhead, containing the information in the example letter provided in Figure 8-1, and providing copies of training certificates.

FIGURE 8-1
TRAINING LETTER

The following statements must be typed on company letterhead and signed by an officer of the company and accompany copies of associated training certificates:

LOGO
XYZ CORPORATION
555 E. 5th Street
Nowheresville, Kansas 55555

Month, day, year

Ralph Basinski
Project Manager
Tetra Tech NUS
Foster Plaza 7
661 Andersen Drive
Pittsburgh, Pennsylvania 15220

Subject: HAZWOPER Training for NSWC Crane

Dear Mr. Basinski:

As an officer of XYZ Corporation, I hereby state that I am aware of potential hazardous nature of the subject project. I also understand that is out responsibility to comply with applicable occupational safety and health regulations including those stipulated in Title 29 of the Code of Federal Regulations (CFR), Parts 1900 through 1910 and Part 126.

I also understand that Title 29 CFR 1910.120 entitled "Hazardous Waste Operations and Emergency Response" requires appropriate level of training for certain employees engaged in hazardous waste operations. In this regard, I hereby state that the following employees have had 40 hours of introductory hazardous waste site training or equivalent work experience as requested by 29 CFR 1910.120(e) and have had 8 hours of refresher training as required by 29 CFR 1910.120(e)(8),

LIST FULL NAMES OF EMPLOYEES AND THEIR SOCIAL SECURITY NUMBERS HERE

Should you have any questions, please contact me at (555) 555-5555.

Sincerely,

(Name of Company Officer)

8.2 SITE-SPECIFIC TRAINING

TtNUS will provide site-specific training to TtNUS employees and subcontractor personnel who will perform work on this project. Site-specific training will also be provided to site visitors (DOD, EPA, etc.) who may enter the site to perform functions that may or may not be directly related to site operations. Site-specific training will include:

- Names of personnel and alternates responsible for site safety and health
- Safety, health and other hazards present on site
- Use of personal protective equipment
- Work practices to minimize risks from hazards
- Safe use of engineering controls and equipment
- Medical surveillance requirements
- Signs and symptoms of overexposure to site contaminants
- The contents of the site-specific health and safety plan including the contents of Table 5-1 and 6-1.
- Emergency response procedures (evacuation and assembly points)
- Spill response procedures
- Review the contents of relevant Material Safety Data Sheets
- Review Safe Work Permits

Site-specific documentation will be established through the use of Figure 8-2. Site personnel and visitors must sign this document upon receiving site-specific training prior to commencement of site activities.

8.3 MEDICAL SURVEILLANCE

8.3.1 Medical Surveillance Requirements For TtNUS Personnel

TtNUS personnel participating in project field activities will have had a physical examination meeting the requirements of TtNUS' medical surveillance program and will be medically qualified to perform hazardous waste site work using respiratory protection.

Documentation for medical clearances will be maintained in the TtNUS Pittsburgh office and made available as necessary.

8.3.2 Medical Surveillance Requirements For Subcontractors

Subcontractor personnel are required to obtain a certificate of their ability to perform hazardous waste site work and to wear respiratory protection. The "Subcontractor Medical Approval Form" provided in Figure 8-3 of this HASP shall be used to satisfy this requirement providing that it is properly completed and signed by a licensed physician.

Subcontractors who have a company medical surveillance program meeting the requirements of paragraph (f) of OSHA 29 CFR 1910.120 can substitute "Subcontractor Medical Approval Form" with a letter, on company letterhead, containing the information in the example letter presented in Figure 8-4.

8.3.3 Requirements for All Field Personnel

Each field team member (including subcontractors and visitors entering the exclusion zone) shall be required to complete and submit a copy of the Medical Data Sheet found in the TtNUS Health and Safety Guidance Manual. This shall be provided to the SSO prior to participating in site activities. The purpose of this document is to provide site personnel and emergency responders with additional information that may be necessary in order to administer medical attention.

8.4 **SUBCONTRACTOR EXCEPTION**

Subcontractors and surveyors who will not enter the exclusion zone during operation, and whose activities involve no potential for exposure to site contaminants, will not be required to meet the requirements for training/medical surveillance, other than site-specific training as stipulated in Section 8-2. **The use of this type of exemption is permissible only with the prior consent of the TtNUS HSM.**

FIGURE 8-3

SUBCONTRACTOR MEDICAL APPROVAL FORM

For employees of _____
Company Name

Participant Name: _____ Date of Exam: _____

Part A

The above-named individual has:

1. Undergone a physical examination in accordance with OSHA Standard 29 CFR 1910.120, paragraph (f) and found to be medically -
 qualified to perform work at the NSWCrane work site
 not qualified to perform work at the NSWCrane work site
and,
2. Undergone a physical examination as per OSHA 29 CFR 1910.134(b)(10) and found to be medically -
 qualified to wear respiratory protection
 not qualified to wear respiratory protection

My evaluation has been based on the following information, as provided to me by the employer.

- A copy of OSHA Standard 29 CFR 1910.120 and appendices.
- A description of the employee's duties as they relate to the employee's exposures.
- A list of known/suspected contaminants and their concentrations (if known).
- A description of any personal protective equipment used or to be used.
- Information from previous medical examinations of the employee which is not readily available to the examining physician.

Part B

I, _____, have examined _____
Physician's Name (print) Participant's Name (print)

and have determined the following information:

**FIGURE 8-3
SUBCONTRACTOR MEDICAL APPROVAL FORM
PAGE TWO**

1. Results of the medical examination and tests (excluding finding or diagnoses unrelated to occupational exposure):

2. Any detected medical conditions that would place the employee at increased risk of material impairment of the employee's health:

3. Recommended limitations upon the employee's assigned work:

I have informed this participant of the results of this medical examination and any medical conditions that require further examination or treatment.

Based on the information provided to me, and in view of the activities and hazard potentials involved at the NSW Crane work site, this participant

- may
 may not

perform his/her assigned task.

Physician's Signature _____

Address _____

Phone Number _____

NOTE: Copies of test results are maintained and available at:

Address

FIGURE 8-4

MEDICAL SURVEILLANCE LETTER

The following statements must be typed on company letterhead and signed by an officer of the company:

LOGO
XYZ CORPORATION
555 E. 5th Street
Nowheresville, Kansas 55555

Month, day, year

Ralph Basinski
Project Manager
Tetra Tech NUS
Foster Plaza 7
661 Andersen Drive
Pittsburgh, Pennsylvania 15220

Subject: Medical Surveillance for NSWCrane

Dear Mr. Basinski:

As an officer of XYZ Corporation, I hereby state that the persons listed below participate in a medical surveillance program meeting the requirements contained in paragraph (f) of Title 29 of the Code of Federal Regulations (CFR), Part 1910.120 entitled "Hazardous Waste Operations and Emergency Response" I further state that the persons listed below have had physical examinations under this program within the past 12 months and that they have been cleared, by a licensed physician, to perform hazardous waste site work and to wear positive and negative pressure respiratory protection. I also state that, to my knowledge, no person listed below has any medical restriction that would preclude him/her from working at the NSWCrane Site.

LIST FULL NAMES OF EMPLOYEES AND THEIR SOCIAL SECURITY NUMBERS HERE

Should you have any questions, please contact me at (555) 555-5555.

Sincerely,

(Name of Company Officer)

9.0 SPILL CONTAINMENT PROGRAM

9.1 SCOPE AND APPLICATION

During this operation hazardous soils and waters are not expected to be encountered. Decontamination fluids will be collected and discharged into the NSWC Crane sanitary sewer system at a designated location. Soil cuttings will be screened for VOC's. If readings are at background levels, the soil will be mixed with bentonite and used to fill the well.

9.2 HAZARDOUS SOILS AND FLUIDS

Quantities of bulk potentially hazardous materials (greater than 55-gallons) will not be handled during site activities conducted as part of the scope of work. If for some reason significant quantities of hazardous waste water (decontamination, and purge) and hazardous IDW is generated as part of site activities the following procedures will be applied. As needed, 55 -gallon drums will be used to contain hazardous waste waters, IDW, and other unwanted items generated during investigatory activities. These drums will be labeled with the site name, drum number, the type of contents (purge waters), volume, the date, point of contact with telephone number.

Samples will be analyzed to characterized the material and determine appropriate disposal measures. Once characterized they can be removed from the staging area and disposed of in accordance with Federal, State and local regulations.

9.3 POTENTIAL SPILL AREAS

Potential spill areas will be monitored in an ongoing attempt to prevent and control further potential contamination of the environment. Currently, there are various areas vulnerable to this hazard including the following:

- Areas used for central staging of resources
- Areas used for central staging of IDW materials
- Decontamination area

Additionally, areas designated for handling, loading, and unloading of potentially contaminated waters, and debris present limited potential for leaks or spills. Monitoring of these areas will be done at least weekly.

9.3.1 Site Drums/Containers

Drums/containers used for containing liquids will be sealed, labeled, and staged within a centralized area awaiting shipment or disposal. Drums used for the storage and transportation of IDW will meet the packaging requirements for steel drums category U.N. 1A2, removable head as specified in paragraph 9.6.1, United Nations Transport of Dangerous Goods.

Staging Area Configuration

The staging area will be configured to support this spill prevention and control program. The area will be configured as follows:

- Where possible secondary containment will be provided. For liquids, this will include a bermed area sufficient in size to hold 10% of the total volume of liquids or the volume of largest container, whichever is greater. This calculation of secondary containment will also consider any displacement by containers or pallets. This bermed area will be lined (plastic liner or other impermeable surface) to prevent any spillage inside the containment from saturating the ground.
- Drums will be organized no more than four to a pallet. The drums label and the head bolt arranged as such to permit reading/review or removal of the head without requiring the drum to be moved on the pallet. Drums will be segregated to site and media. A minimum of two feet shall be maintained between each row of pallets to permit access for spill response measures.

9.4 LEAK AND SPILL DETECTION

To establish an early detection of potential spills or leaks, a periodic (once a week) walk around by the SSO will be conducted during working hours to visually determine that containers are not leaking. If a leak is detected, the first approach will be to transfer the container contents using a hand pump into a new container. Other provisions for the transfer of container contents will be made and appropriate emergency contacts will be notified, if necessary. In most instances, leaks will be collected and contained using absorbents such as oil-dry, vermiculite, or sand, which will be stored at the staging area in a conspicuously marked drum. This material too, will be containerized for disposal pending analyses. Inspections will be documented in the project logbook.

9.5 PERSONNEL TRAINING AND SPILL PREVENTION

Personnel will be instructed on the procedures for spill prevention, containment, and collection of hazardous materials in the site-specific training. The FOL and/or the SSO will serve as the Spill Response Coordinator for this operation should the need arise.

9.6 SPILL PREVENTION AND CONTAINMENT EQUIPMENT

The following represents the minimum equipment which will be maintained at the staging area for the purpose of supporting this Spill Prevention/Containment Program.

Spill Response Equipment:

- Sand, clean fill, vermiculite, or other noncombustible absorbent (oil-dry);
- Drums (55-gallon U.N 1A2)
- Portable storage tanks or additional drums
- Shovels, rakes, and brooms
- Labels

PPE stored at the staging area:

- Rubber boot covers, nitrile outer gloves, PVC rain-suit or other form of impermeable splash protection, should it be required.

9.7 SPILL CONTROL PLAN

This section describes the procedures the TtNUS field crew members will employ upon the detection of a spill or leak.

- 1) Notify the SSO or FOL immediately upon the detection of a leak or spill.
- 2) Employ the personnel protective equipment stored at the staging area. Take immediate actions to stop the leak or spill by plugging or patching the drum or raising the leak to the highest point. Spread the absorbent material in the area of the spill covering completely.
- 3) Transfer the material to a new container, collect and containerize the absorbent material. Label the new container appropriately. Await analyses for treatment or disposal options.

- 4) Spills occurring on soils, grassy areas, gravel lots will be re-containerized including 2-inches of top cover on which the spill occurred, and await test results for treatment or disposal options.

It is not anticipated that a spill will occur in which the field crews cannot handle. Should this occur notification of appropriate emergency response agencies will be carried out by the FOL or SSO.

10.0 SITE CONTROL

This section outlines the means by which TtNUS will delineate work zones and use these work zones in conjunction with decontamination procedures to prevent the spread of contaminants into previously unaffected areas of the site. It is anticipated that a three-zone approach will be used during work at this site. This three zone approach will utilize an exclusion zone, a contamination reduction zone, and a support zone. It is also anticipated that this control measure will be used to control access to site work areas. Use of such controls will restrict the general public, minimize the potential for the spread of contaminants, and protect individuals who are not cleared to enter work areas.

10.1 EXCLUSION ZONE

The exclusion zone will be considered those areas of the site of known or suspected contamination. It is not anticipated that significant amounts of surface contamination are present in the proposed work areas of this site. The exclusion zone for this activity will be fragmented to represent the areas where the soil is disturbed through intrusive activities. When necessary, exclusion zones will be delineated using barrier tape, cones and/or drive poles, and postings to inform personnel other than the field crew. The exclusion zones for this project will be limited to those areas of the site where active work is being performed:

- Soil Boring Activity (HSA, DPT). The exclusion zone for this activity will be set at the height of the mast, plus five feet surrounding the point of operation, with a minimum of 25 feet. This distance will also apply when subsurface soil sampling from behind these type rigs.
- Decontamination operation. The exclusion zone for this activity will be set at 25 feet surrounding the gross contamination wash and rinse as well as 25 feet surrounding the heavy equipment decontamination area.
- IDW area will be delineated. Only authorized personnel should be allowed access.

10.1.1 Exclusion Zone Clearance

Access to work areas will be controlled by TtNUS personnel. No persons will be permitted to enter site exclusion zones without site-specific training. Site visitors will be provided site-specific training and will be escorted by TtNUS personnel (see Section 10.4).

10.2 CONTAMINATION REDUCTION ZONE

The contamination reduction zone (CRZ) will be a buffer area between the exclusion zone and any area of the site where contamination is not suspected. The personnel and equipment decontamination will not

take place in this area, but will take place at a central location established for this project. This area instead will serve as a focal point in supporting exclusion zone activities: When applicable, this area will be delineated using barrier tape, cones and/or drive poles, and postings to inform and direct facility personnel.

10.3 SUPPORT ZONE

The support zone for this project will be the area where site vehicles will be parked, equipment will be unloaded, and where food and drink containers will be maintained. The support zones will be established at areas of the site where exposure to site contaminants would not be expected during normal working conditions or foreseeable emergencies.

10.4 SITE VISITORS

Site visitors for the purpose of this document are identified as representing the following groups of individuals:

- Personnel invited to observe or participate in operations by TtNUS
- Regulatory personnel (EPA, OSHA, etc.)
- NSWCrane or DOD Personnel
- Other authorized visitors

Personnel working on this project are required to gain initial access to the NSWCrane by coordinating with the TtNUS FOL or designee and following established NSWCrane access procedures.

Once access to NSWCrane is obtained personnel who require site access into areas of ongoing operations will be required to obtain permission from the FOL and SSO. The prerequisites for site visitors wishing to observe operations in progress in the exclusion zone are discussed below:

- Site visitors will be routed to the FOL, who will sign them into the field logbook. Information to be recorded in the logbook will include the individual's name (proper identification required), the entity which they represent, and the purpose of the visit.
- Site visitors will be required to produce the necessary information supporting clearance to the site. This shall include information attesting to applicable training (40-hours of HAZWOPER training) and medical surveillance as stipulated in Section 8.0 of this document. In addition, to enter the site operational zones during planned activities, visitors will be required to first go through site-specific training covering the topics stipulated in Section 8.2 of this HASP.

Once the site visitors have completed the above items, they will be permitted to enter the operational zone. Visitors are required to observe the protective equipment and site restrictions in effect at the site at the time of their visit. Any unauthorized site visitation will cause the termination of on-site activities until the unauthorized visitor is removed from the area. Removal of unauthorized visitors will be accomplished with support from the Base Contact and Base Security. Site visitors granted access to the exclusion zones during ongoing operations will be escorted by a TtNUS representative (arranged for by the FOL) while the visitor remains in the exclusion zone.

10.5 SITE SECURITY

TtNUS will retain control over active operational areas. The FOL will serve as a focal point for site personnel, and will serve as the final line of security for the work areas. Work will cease in the event of unauthorized personnel entering the exclusion zone. Work will remain temporarily suspended until the unauthorized visitor can be removed. The Base Contact will serve as the primary enforcement contact for removing unauthorized visitors.

10.6 SITE MAP

Once the areas of contamination, access routes, utilities, topography, and dispersion routes are determined, a site map will be generated and adjusted as site conditions change. These maps will show utility locations, potential points of contact with the public, roadways, and other significant characteristics that may impact site operations and safety. Site maps will be posted to illustrate up-to-date collection of contaminants and adjustment of zones and access points.

10.7 BUDDY SYSTEM

Personnel engaged in on-site activities will practice the "buddy system" to ensure the safety of the personnel involved in this operation.

10.8 MATERIAL SAFETY DATA SHEET (MSDS) REQUIREMENTS

TtNUS personnel will provide MSDSs for chemicals brought on-site. The contents of these documents will be reviewed by the SSO with the user(s) of the chemical substances prior to any actual use or application of these substances on site. A chemical inventory of chemicals used on site will be developed. (See Section 5.0 of the Health and Safety Guidance Manual) A copy of the Chemical Inventory List will be provided to the Fire Department, as they would serve as primary responders to the work/storage building should the need arise. The MSDSs will then be maintained in a central location and will be available for anyone to review upon request.

10.9 COMMUNICATION

As personnel may not always be working in proximity to one another during field activities, a supported means of communication between field crews will be used as necessary. As a result, two-way radio communication devices will be used by field personnel while at the site. Two-way radio communications intended for use at NSWCC Crane, will have GSA approval prior to being brought on-site for use.

External communication will be accomplished by using provided telephones at the site. External communication will primarily be used for the purpose of resource and emergency resource communications.

10.10 SAFE WORK PERMITS

Work conducted in support of this project will be performed using Safe Work Permits to guide and direct field crews on a task by task basis. An example of the permit to be used is illustrated in Figure 10-1. Attachment V contains partially completed permit for tasks that are to be performed as part of the investigation. Information such as field crew performing the task, date, time, procedure reviews, and equipment preparation information need to be completed by the FOL or SSO prior to the initiation of site activities. The Safe Work Permit will be further supported by the daily safety meetings. This effort will ensure site-specific considerations and changing conditions are incorporated into the planning effort. Permits will require the signature of the FOL and/or SSO. Personnel engaged in on-site activities will be aware of the elements indicating levels of protection and precautionary measures to be used.

Use of these permits will provide the communication line for reviewing protective measures and hazards associated with each operation. This HASP will be used as the primary reference for selecting levels of protection and control measures. The Safe Work Permit will take precedence over the HASP when more conservative measures are required based on specific site conditions.

Upon completion of work specified on the Safe Work Permit, the person accepting the permit will return it to the SSO.

Any problems encountered regarding control measures taken will be annotated on the permit or a separate sheet of paper and returned to the SSO for review and evaluation.

**FIGURE 10-1
SAFE WORK PERMIT**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope (To be filled in by person performing work)

- I. Work limited to the following (description, area, equipment used): _____

- II. Names: _____

- III. On-site Inspection conducted Yes No Initials of Inspector TtNUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- IV. Protective equipment required
 Level D Level B
 Level C Level A
 Detailed on Reverse
- Respiratory equipment required
 Full face APR
 Half face APR
 SAR
 Skid Rig
- Escape Pack
 SCBA
 Bottle Trailer
 None

Modifications/Exceptions: _____

V. Chemicals of Concern	Action Level(s)	Response Measures
_____	_____	_____
_____	_____	_____

- VI. Additional Safety Equipment/Procedures
- | | |
|--|--|
| Hard-hat <input type="checkbox"/> Yes <input type="checkbox"/> No | Hearing Protection (Plugs/Muffs)..... <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Safety Glasses <input type="checkbox"/> Yes <input type="checkbox"/> No | Safety belt/harness <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Chemical/splash goggles <input type="checkbox"/> Yes <input type="checkbox"/> No | Radio <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Splash Shield <input type="checkbox"/> Yes <input type="checkbox"/> No | Barricades..... <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Splash suits/coveralls..... <input type="checkbox"/> Yes <input type="checkbox"/> No | Gloves (Type) <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Steel toe Work shoes or boots <input type="checkbox"/> Yes <input type="checkbox"/> No | Work/rest regimen <input type="checkbox"/> Yes <input type="checkbox"/> No |
- Modifications/Exceptions: _____

- VII. Procedure review with permit acceptors
- | | | | |
|--|--------------------------|---|--------------------------|
| Yes | NA | Yes | NA |
| Safety shower/eyewash (Location & Use)..... <input type="checkbox"/> | <input type="checkbox"/> | Emergency alarms..... <input type="checkbox"/> | <input type="checkbox"/> |
| Procedure for safe job completion..... <input type="checkbox"/> | <input type="checkbox"/> | Evacuation routes..... <input type="checkbox"/> | <input type="checkbox"/> |
| Contractor tools/equipment/PPE inspected..... <input type="checkbox"/> | <input type="checkbox"/> | Assembly points <input type="checkbox"/> | <input type="checkbox"/> |

- VIII. Site Preparation
- | | | |
|--|--------------------------|--------------------------|
| Yes | No | NA |
| Utility Locating and Excavation Clearance completed..... <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| Equipment and Foot Traffic Routes Cleared and Established <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| Physical Hazards Barricaded and Isolated..... <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| Emergency Equipment Staged..... <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

- IX. Additional Permits required (Hot work, confined space entry, excavation etc.)..... Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

- X. Special instructions, precautions: _____

Permit Issued by: _____ Permit Accepted by: _____

11.0 CONFINED SPACE ENTRY

Personnel under the provisions of this HASP are not allowed, under any circumstances, to enter confined spaces. A confined space is defined as an area that has one or more of the following characteristics:

- Is large enough and so configured that an employee can bodily enter and perform assigned work.
- Has limited or restricted means for entry or exit (for example, tanks, vessels, silos, storage bins, hoppers, vaults, and pits are spaces that may have limited means of entry).
- Is not designed for continuous employee occupancy.
- Contains or has a potential to contain a hazardous atmosphere.
- Contains a material that has the potential to engulf an entrant.
- Has an internal configuration such that an entrant could be trapped or asphyxiated by inwardly converging walls or by a floor that slopes downward and tapers to a smaller cross-section.
- Contains any other recognized, serious, safety or health hazard.

For further information on confined space consult the Health and Safety Guidance Manual or call the Manager, Health Sciences. If confined space operations are to be performed as part of the scope of work, detailed procedures and training requirements will be addressed in an addendum or the site specific health and safety plan.

12.0 MATERIALS AND DOCUMENTS

The TiNUS FOL shall ensure the following materials/documents are taken to the project site and used when required.

- A complete copy of this HASP
- Health and Safety Guidance Manual
- Incident Reports
- Medical Data Sheets
- Material Safety Data Sheets for chemicals brought on site, including decon solutions, fuels, lime, sample preservatives, calibration gases, etc.
- A full-size OSHA Job Safety and Health Poster (posted in the site trailers)
- Training/Medical Surveillance Documentation Form (Blank)
- Emergency Reference Information (Section 2.0, extra copy for posting)

12.1 MATERIALS TO BE POSTED OR MAINTAINED AT THE SITE

The following documentation is to be posted or maintained at the site for quick reference purposes. In situations where posting these documents is not feasible, (such as no office trailer), these documents should be separated and immediately accessible.

Chemical Inventory Listing (posted) - This list represents chemicals brought on-site, including decontamination solutions, sample preservations, fuel, etc.. This list should be posted in a central area.

Material Safety Data Sheets (MSDS) (maintained) - The MSDSs should also be in a central area accessible to site personnel. These documents should match the listings on the chemical inventory list for substances used on-site. It is acceptable to have these documents within a central folder and the chemical inventory as the table of contents.

The OSHA Job Safety & Health Protection Poster (posted) - this poster, as directed by 29 CFR 1903.2 (a)(1), should be conspicuously posted in places where notices to employees are normally posted. Each FOL shall ensure that this poster is not defaced, altered, or covered by other material.

Site Clearance (maintained) - This list is found within the training section of the HASP (See Figure 8-2). This list identifies site personnel, dates of training (including site-specific training), and medical surveillance. The list indicates not only clearance but also status. If personnel do not meet these requirements, they do not enter the site while site personnel are engaged in activities.

Emergency Phone Numbers and Directions to the Hospital(s) (posted) - This list of numbers and directions will be maintained at phone communications points and in each site vehicle.

Medical Data Sheets/Cards (maintained) - Medical Data Sheets will be filled out by on-site personnel and filed in a central location. The Medical Data Sheet will accompany any injury or illness requiring medical attention to the medical facility. a copy of this sheet or a wallet card will be given to personnel to be carried on their person.

Hearing Conservation Standard (29 CFR 1910.95) (posted) - this standard will be posted anytime hearing protection or other noise abatement procedures are employed.

Personnel Monitoring (maintained) - Results generated through personnel sampling (levels of airborne toxins, noise levels, etc.) will be posted to inform individuals of the results of that effort.

Placards and Labels (maintained) - Where chemical inventories have been separated because of quantities and incompatibilities, these areas will be conspicuously marked using DOT placards and acceptable (Hazard Communication 29 CFR 1910.1200(f)) labels.

The purpose of maintaining or posting this information, as stated above, is to allow site personnel quick access. Variations concerning location and methods of presentation are acceptable, providing the objection is accomplished.

13.0 GLOSSARY

ACGIH	American Conference of Governmental Industrial Hygienists
APR	Air Purifying Respirators
CAAA	Crane Army Ammunition Activity
CFR	Code of Federal Regulations
CIH	Certified Industrial Hygienist
CLEAN	Comprehensive Long-Term Environmental Action Navy
CNS	Central Nervous System
CQP	Construction Quality Plan
CSP	Certified Safety Professional
CTO	Contract Task Order
DR	Demolition Range
DRI	Direct Reading Instruments
DPT	Direct Push Technology
eV	electron Volts
FID	Flame Ionization Detector
FOL	Field Operations Leader
HSGM	Health and Safety Guidance Manual
HASP	Health and Safety Plan
HAZWOPER	Hazardous Waste Operations and Emergency Response
HEPA	High Efficiency Particulate Air
HSA	Hollow Stem Auger
HSM	Health and Safety Manager
HMX	Cyclotetramethylene tetranitramine Octagen,
IDLH	Immediately Dangerous to Life and Health
IDW	Investigative Derived Waste
NAD	Naval Ammunition Depot
N/A	Not Available
NIOSH	National Institute Occupational Safety and Health
NSWC	Naval Surface Warfare Center
MEK	Methyl Ethyl Ketone
MTV	Magnesium Teflon Viton
OB/OD	Open Burning/Open Detonation
OSHA	Occupational Safety and Health Administration (U.S. Department of Labor)

PCB	Polychlorinated Biphenyl
PEL	Permissible Exposure Limit
PHSO	Project Health and Safety Manager
PID	Photo Ionization Detector
PM	Project Manager
PPE	Personal Protective Equipment
PPM	Parts Per Million
PVC	Poly Vinyl Chloride
RCRA	Resource Conservation and Recovery Act
RDX	Cyclo-1,3,5-trimethylene-2,4,6-trinitramine
SAP	Sampling and Analyses Plan
SCBA	Self Contained Breathing Apparatus
SSO	Site Safety Officer
STEL	Short Term Exposure Limit
SVOC	Semi Volatile Organic Compound
SWL	Sanitary Waste Landfill
SWMU	Solid Waste Management Unit
TBD	To Be Determined
TCE	Trichloroethylene
TNT	Trinitrotoluene
TOM	Task Order Manager
TWA	Time Weighted Average
UV	Ultra Violet
VOC	Volatile Organic Compound
WP	Work Plan

ATTACHMENT I

**INJURY/ILLNESS PROCEDURE
AND REPORT FORM**

TETRA TECH NUS, INC.

INJURY/ILLNESS PROCEDURE WORKER'S COMPENSATION PROGRAM

WHAT YOU SHOULD DO IF YOU ARE INJURED OR DEVELOP AN ILLNESS AS A RESULT OF YOUR EMPLOYMENT:

- If injury is minor, obtain appropriate first aid treatment.
- If injury or illness is severe or life threatening, obtain professional medical treatment at the nearest hospital emergency room.
- If incident involves a chemical exposure on a project work site, follow instructions in the Health & Safety Plan.
- Immediately report any injury or illness to your supervisor or office manager. In addition, you must contact your Human Resources representative, Marilyn Duffy at (412) 921-8475, and the Corporate Health and Safety Manager, Matt Soltis at (412) 921-8912 within 24 hours. You will be required to complete an Injury/Illness Report (attached). You may also be required to participate in a more detailed investigation from the Health Sciences Department.
- If further medical treatment is needed, The Hartford Network Referral Unit will furnish a list of network providers customized to the location of the injured employee. These providers are to be used for treatment of Worker's Compensation injuries subject to the laws of the state in which you work. Please call Marilyn Duffy at (412) 921-8475 for the number of the Referral Unit.

ADDITIONAL QUESTIONS REGARDING WORKER'S COMPENSATION:

Contact your local human resources representative, corporate health and safety coordinator, or Corporate Administration in Pasadena, California, at (626) 351-4664.

Worker's compensation is a state-mandated program that provides medical and disability benefits to employees who become disabled due to job related injury or illness. Tetra Tech, Inc. and its subsidiaries (Tetra Tech or Company) pay premiums on behalf of their employees. The type of injuries or illnesses covered and the amount of benefits paid are regulated by the state worker's compensation boards and vary from state to state. Corporate Administration in Pasadena is responsible for administering the Company's worker's compensation program. The following is a general explanation of worker's compensation provided in the event that you become injured or develop an illness as a result of your employment with Tetra Tech or any of its subsidiaries. Please be aware that the term used for worker's compensation varies from state to state.

WHO IS COVERED:

All employees of Tetra Tech, whether they are on a full-time, part-time or temporary status, working in an office or in the field, are entitled to worker's compensation benefits. All

TETRA TECHNUS, INC.
INJURY/ILLNESS PROCEDURE
WORKER'S COMPENSATION PROGRAM

employees must follow the above injury/illness reporting procedures. Consultants, independent contractors, and employees of subcontractors are not covered by Tetra Tech's Worker's Compensation plan.

WHAT IS COVERED:

If you are injured or develop an illness caused by your employment, worker's compensation benefits are available to you subject to the laws of the state you work in. Injuries do not have to be serious; even injuries treated by first aid practices are covered and must be reported. Please note that if you are working out-of-state and away from your home office, you are still eligible for worker's compensation benefits.



TETRA TECH, INC.

ACCIDENT AND ILLNESS INVESTIGATION REPORT

To: _____ Prepared by: _____
 Subsidiary Health and Safety Representative
 Position: _____
 cc: _____ Office: _____
 Workers Compensation Administrator
 Project name: _____ Telephone number: _____
 Project number: _____ Fax number: _____

Information Regarding Injured or Ill Employee

Name: _____ Office: _____
 Home address: _____ Gender: M F No. of dependents: _____
 _____ Marital status: _____
 Home telephone number: _____ Date of birth: _____
 Occupation (regular job title): _____ Social security number: _____
 Department: _____

Date of Accident: _____ Time of Accident: _____ a.m. p.m.
 Time Employee Began Work: _____ Check if time cannot be determined

Location of Incident

Street address: _____
 City, state, and zip code: _____
 County: _____
 Was place of accident or exposure on employer's premises? Yes No

Information About the Incident

What was the employee doing just before the incident occurred? Describe the activity as well as the tools, equipment, or material the employee was using. Be specific. Examples: "Climbing a ladder while carrying roofing materials"; "Spraying chlorine from hand sprayer"; "Daily computer key-entry"

What Happened? Describe how the injury occurred. Examples: "When ladder slipped on wet floor, worker fell 20 feet"; "Worker was sprayed with chlorine when gasket broke during replacement"; "Worker developed soreness in wrist over time"

This form contains information relating to employee health and must be used in a manner that protects the confidentiality of the employee to the extent possible while the information is being used for occupational safety and health purposes.



TETRA TECH, INC.

ACCIDENT AND ILLNESS INVESTIGATION REPORT (Continued)

Information About the Incident (Continued)

What was the injury or illness? Describe the part(s) of the body affected and how it was affected. Be more specific than "hurt," "pain," or "sore." Examples "Strained back"; "Chemical burn, right hand"; "Carpal tunnel syndrome, left wrist"

Describe the Object or Substance that Directly Harmed the Employee: Examples: "Concrete floor"; "Chlorine"; "Radial arm saw." If this question does not apply to the incident, write "Not applicable."

Did the employee die? Yes [] No [] Date of death: _____

Was employee performing regular job duties? Yes [] No []

Was safety equipment provided? Yes [] No [] Was safety equipment used? Yes [] No []

Note: Attach any police reports or related diagrams to this report.

Witness (Attach additional sheets for other witnesses.)

Name: _____

Company: _____

Street address: _____

City: _____ State: _____ Zip code: _____

Telephone number: _____

Medical Treatment Required? [] Yes [] No [] First aid only

Name of physician or health care professional: _____

If treatment was provided away from the work site, provide the information below.

Facility name: _____

Street address: _____

City: _____ State: _____ Zip code: _____

Telephone number: _____

Was the employee treated in an emergency room? [] Yes [] No

Was the employee hospitalized over night as an in-patient? [] Yes [] No

This form contains information relating to employee health and must be used in a manner that protects the confidentiality of the employee to the extent possible while the information is being used for occupational safety and health purposes.



TETRA TECH, INC.

ACCIDENT AND ILLNESS INVESTIGATION REPORT (Continued)

Corrective Action(s) Taken by Unit Reporting the Accident:

Corrective Action Still to be Taken (by whom and when):

Name of Tetra Tech employee the injury or illness was first reported to: _____

Date of Report: _____ Time of Report: _____

I have reviewed this investigation report and agree, to the best of my recollection, with its contents.

Printed Name of Injured Employee

Telephone Number

Signature of Injured Employee

Date

The signatures provided below indicate that appropriate personnel have been notified of the incident.

Title	Printed Name	Signature	Telephone Number	Date
Office Manager				
Project Manager				
Site Safety Coordinator or Office Health and Safety Representative				

This form contains information relating to employee health and must be used in a manner that protects the confidentiality of the employee to the extent possible while the information is being used for occupational safety and health purposes.



TETRA TECH, INC.

ACCIDENT AND ILLNESS INVESTIGATION REPORT (Continued)

To Be Completed by the Subsidiary Health and Safety Representative

Classification of Incident:

Injury Illness

Result of Incident:

- First aid only
 Days away from work
 Remained at work but incident resulted in job transfer or work restriction
 Incident involved days away and job transfer or work restriction
 Medical treatment only

No. of days away from work
Date employee left work
Date employee returned to work
No. of days placed on restriction or job transfer:

OSHA Recordable Case Number

To Be Completed by Human Resources

Social security number:
Date of hire: Hire date for current job:
Wage information: \$ per Hour Day Week Month
Position at time of hire:
Current position: Shift hours:
State in which employee was hired:
Status: Full-time Part-time Hours per week: Days per week:
Temporary job end date:

To Be Completed during Report to Workers Compensation Carrier

Date reported: Reported by:
Confirmation number:
Name of contact:
Field office of claims adjuster:

This form contains information relating to employee health and must be used in a manner that protects the confidentiality of the employee to the extent possible while the information is being used for occupational safety and health purposes.

**ATTACHMENT II
MEDICAL DATA SHEET**

MEDICAL DATA SHEET

This Medical Data Sheet must be completed by all on-site personnel and kept in the command post during the conduct of site operations. This data sheet will accompany any personnel when medical assistance is needed or if transport to hospital facilities is required.

Project _____

Name _____ Home Telephone _____

Address _____

Age _____ Height _____ Weight _____

Name of Next Kin _____

Drug or other Allergies _____

Particular Sensitivities _____

Do You Wear Contacts? _____

Provide a Checklist of Previous Illnesses or Exposure to Hazardous Chemicals _____

What medications are you presently using? _____

Do you have any medical restrictions? _____

Name, Address, and Phone Number of personal physician: _____

I am the individual described above. I have read and understand this HASP.

Signature

Date

ATTACHMENT III

**UTILITY LOCATING
AND
EXCAVATION CLEARANCE**



TETRA TECH NUS, INC.

STANDARD OPERATING PROCEDURES

Number	HS-1.0	Page	1 of 11
Effective	03/00	Date	Revision
			1
Applicability	Tetra Tech NUS, Inc.		
Prepared	Health & Safety		
Approved	D. Senovich <i>DS</i>		

Subject
UTILITY LOCATING AND EXCAVATION CLEARANCE

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
1.0 PURPOSE	2
2.0 SCOPE	2
3.0 GLOSSARY	2
4.0 RESPONSIBILITIES.....	2
5.0 PROCEDURES.....	3
5.1 BURIED UTILITIES	3
5.2 OVERHEAD POWER LINES	4
6.0 UNDERGROUND LOCATING TECHNIQUES.....	5
6.1 GEOPHYSICAL METHODS.....	5
6.2 PASSIVE DETECTION SURVEYS	6
6.3 INTRUSIVE DETECTION SURVEYS.....	6
7.0 INTRUSIVE ACTIVITIES SUMMARY	7
8.0 REFERENCES	7

ATTACHMENTS

1	Listing of Underground Utility Clearance Resources	8
2	Frost Line Penetration Depths by Geographic Location	10
3	Utility Clearance Form	11

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 2 of 11
	Revision 1	Effective Date 03/00

1.0 PURPOSE

Utilities such as electric service lines, natural or propane gas lines, water and sewage lines, telecommunications, and steam lines are very often in the immediate vicinity of work locations. Contact with underground or overhead utilities can have serious consequences including employee injury/fatality, property and equipment damage, substantial financial impacts, and loss of utility service to users.

The purpose of this procedure is to provide minimum requirements and technical guidelines regarding the appropriate procedures to be followed when performing subsurface and overhead utility locating services. It is the policy of Tetra Tech NUS, Inc. (TtNUS) to provide a safe and healthful work environment for the protection of our employees. The purpose of this Standard Operating Procedure (SOP) is to aid in achieving the objectives of the TtNUS Utility Locating and Clearance Policy. The TtNUS Utility Locating and Clearance Policy must be reviewed by anyone potentially involved with underground or overhead utility services.

2.0 SCOPE

This procedure applies to all TtNUS field activities where there may be potential contact with underground or overhead utilities. This procedure provides a description of the principles of operation, instrumentation, applicability, and implementability of typical methods used to determine the presence or absence of utility services. This procedure is intended to assist with work planning and scheduling, resource planning, field implementation, and subcontractor procurement. Utility locating and excavation clearance requires site-specific information prior to the development of detailed operating procedures. This guidance is not intended to provide a detailed description of methodology and instrument operation. Specialized expertise during both planning and execution of several of the geophysical methods may also be required.

3.0 GLOSSARY

Electromagnetic Induction (EMI) Survey - A geophysical exploration method whereby electromagnetic fields are induced in the ground and the resultant secondary electromagnetic fields are detected as a measure of ground conductivity.

Magnetometer - A device used for precise and sensitive measurements of magnetic fields.

Magnetic Survey - A geophysical survey method that depends on detection of magnetic anomalies caused by the presence of buried ferromagnetic objects.

Metal Detection - A geophysical survey method that is based on electromagnetic coupling caused by underground conductive objects.

Vertical Gradiometer - A magnetometer equipped with two sensors that are vertically separated by a fixed distance. It is best suited to map near surface features and is less susceptible to deep geologic features.

Ground Penetrating Radar - Ground Penetrating Radar (GPR) involves specialized radar equipment whereby a signal is sent into the ground via a transmitter. Some portion of the signal will be reflected from the subsurface material, which is then recorded with a receiver and electronically converted into a graphic picture.

4.0 RESPONSIBILITIES

Project Manager (PM)/Task Order Manager (TOM) - Responsible for ensuring that all field activities are conducted in accordance with this procedure and the TtNUS Utility Locating and Clearance Policy.

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 3 of 11
	Revision 1	Effective Date 03/00

Site Manager (SM)/Field Operations Leader (FOL) - Responsible for the onsite verification that all field activities are performed in compliance with approved SOPs or as otherwise directed by the approved project plan(s).

Site Health & Safety Officer (SHSO) – Responsible to provide technical assistance and verify full compliance with this SOP and the TtNUS Utility Locating and Clearance Policy. The SHSO is also responsible for reporting any deficiencies to the Corporate Health and Safety Manager (HSM) and to the PM/TOM.

Health & Safety Manager (HSM) – Responsible for preparing, implementing, and modifying corporate health and safety policy.

Site Personnel – Responsible for understanding and implementing this SOP and the TtNUS Utility Locating and Clearance Policy.

5.0 PROCEDURES

This procedure addresses the requirements and technical procedures that must be performed to minimize the potential for contact with underground and overhead utility services. These procedures are addressed individually from a buried and overhead standpoint.

5.1 Buried Utilities

Buried utilities present a heightened concern because their location is not typically obvious by visual observation, and it is common that their presence and/or location is unknown or incorrectly known on client properties. The following procedure must be followed prior to beginning any excavation that might potentially be in the vicinity of underground utility services. In addition, the Utility Clearance Form (Attachment 3) must be completed for every location or cluster of locations where intrusive activities will occur.

Where the positive identification and de-energizing of underground utilities cannot be obtained and confirmed using the following steps, the PM/TOM is responsible for arranging for the procurement of a qualified, experienced, utility locating subcontractor who will accomplish the utility location and demarcation duties specified herein.

1. A comprehensive review must be made of any available property maps, blue lines, or as-builts prior to site activities. Interviews with local personnel familiar with the area should be performed to provide additional information concerning the location of potential underground utilities. Information regarding utility locations shall be added to project maps upon completion of this exercise.
- 2., A visual site inspection must be performed to compare the site plan information to actual field conditions. Any findings must be documented and the site plan/maps revised. The area(s) of proposed excavation or other subsurface activities must be marked at the site in white paint or pin flags to identify those locations of the proposed intrusive activities. The site inspection should focus on locating surface indications of potential underground utilities. Items of interest include the presence of nearby area lights, telephone service, drainage grates, fire hydrants, electrical service vaults/panels, asphalt/concrete scars and patches, and topographical depressions. Note the location of any emergency shut off switches. Any additional information regarding utility locations shall be added to project maps upon completion of this exercise and returned to the PM/TOM.

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 4 of 11
	Revision 1	Effective Date 03/00

3. If the planned work is to be conducted on private property (e.g., military installations, manufacturing facilities, etc.) the FOL must identify and contact appropriate facility personnel (e.g., public works or facility engineering) before any intrusive work begins to inquire about (and comply with) property owner requirements. It is important to note that private property owners may require several days to several weeks advance notice prior to locating utilities.
4. If the work location is on public property, the state agency that performs utility clearances must be notified (see Attachment 1). State "one-call" services must be notified prior to commencing fieldwork per their requirements. Most one-call services require, by law, 48- to 72-hour advance notice prior to beginning any excavation. Such services typically assign a "ticket" number to the particular site. This ticket number must be recorded for future reference and is valid for a specific period of time, but may be extended by contacting the service again. The utility service will notify utility representatives who then mark their respective lines within the specified time frame. It should be noted that most military installations own their own utilities but may lease service and maintenance from area providers. Given this situation, "one call" systems may still be required to provide location services on military installations.
5. Utilities must be identified and their locations plainly marked using pin flags, spray paint, or other accepted means. The location of all utilities must be noted on a field sketch for future inclusion on project maps. Utility locations are to be identified using the following industry-standard color code scheme, unless the property owner or utility locator service uses a different color code:

white	excavation/subsurface investigation location
red	electrical
yellow	gas, oil, steam
orange	telephone, communications
blue	water, irrigation, slurry
green	sewer, drain
6. Where utility locations are not confirmed with a high degree of confidence through drawings, schematics, location services, etc., the work area must be thoroughly investigated prior to beginning the excavation. In these situations, utilities must be identified using such methods as passive and intrusive surveys, physical probing, or hand augering. Each method has advantages and disadvantages including complexity, applicability, and price. It also should be noted that in many states, initial excavation is required by hand to a specified depth.
7. At each location where trenching or excavating will occur using a backhoe or other heavy equipment, and where utility identifications and locations cannot be confirmed prior to groundbreaking, the soil must be probed with a hand auger or pole (tile probe) made of non-conductive material. If these efforts are not successful in clearing the excavation area of suspect utilities, hand shoveling must be performed for the perimeter of the intended excavation.
8. All utilities uncovered or undermined during excavation must be structurally supported to prevent potential damage. Unless necessary as an emergency corrective measure, TtNUS shall not make any repairs or modifications to existing utility lines without prior permission of the utility owner, property owner, and Corporate HSM. All repairs require that the line be locked-out/tagged-out prior to work.

5.2 Overhead Power Lines

If it is necessary to work within the minimum clearance distance of an overhead power line, the overhead line must be de-energized and grounded, or re-routed by the utility company or a registered electrician. If protective measures such as guarding, isolating, or insulating are provided, these precautions must be

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 5 of 11
	Revision 1	Effective Date 03/00

adequate to prevent employees from contacting such lines directly with any part of their body or indirectly through conductive materials, tools, or equipment.

The following table provides the required minimum clearances for working in proximity to overhead power lines.

<u>Nominal Voltage</u>	<u>Minimum Clearance</u>
0 -50 kV	10 feet, or one mast length; whichever is greater
50+ kV	10 feet plus 4 inches for every 10 kV over 50 kV or 1.5 mast lengths; whichever is greater

6.0 UNDERGROUND LOCATING TECHNIQUES

6.1 Geophysical Methods

Geophysical methods include electromagnetic induction, magnetics, and ground penetrating radar. Additional details concerning the design and implementation of electromagnetic induction, magnetics, and ground penetrating radar surveys can be found in one or more of the TtNUS SOPs included in the References (Section 8.0).

Electromagnetic Induction

Electromagnetic Induction (EMI) line locators operate either by locating a background signal or by locating a signal introduced into the utility line using a transmitter. A utility line acts like a radio antenna, producing electrons, which can be picked up with a radiofrequency receiver. Electrical current carrying conductors have a 60HZ signal associated with them. This signal occurs in all power lines regardless of voltage. Utilities in close proximity to power lines or used as grounds may also have a 60HZ signal, which can be picked up with an EM receiver. A typical example of this type of geophysical equipment is an EM-61.

EMI locators specifically designed for utility locating use a special signal that is either indirectly induced onto a utility line by placing the transmitter above the line or directly induced using an induction clamp. The clamp induces a signal on the specific utility and is the preferred method of tracing since there is little chance of the resulting signals being interfered with. A good example of this type of equipment is the Schonstedt® MAC-51B locator. The MAC-51B performs inductively traced surveys, simple magnetic locating, and traced nonmetallic surveys.

When access can be gained inside a conduit to be traced, a flexible insulated trace wire can be used. This is very useful for non-metallic conduits but is limited by the availability of gaining access inside the pipe.

Magnetics

Magnetic locators operate by detecting the relative amounts of buried ferrous metal. They are incapable of locating or identifying nonferrous utility lines but can be very useful for locating underground storage tanks (UST's), steel utility lines, and buried electrical lines. A typical example of this type of equipment is the Schonstedt® GA-52Cx locator. The GA-52Cx is capable of locating 4-inch steel pipe up to 8 feet deep.

Non-ferrous lines are often located by using a typical plumbing tool (snake) fed through the line. A signal is then introduced to the snake that is then traced.

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 6 of 11
	Revision 1	Effective Date 03/00

Ground Penetrating Radar

Ground Penetrating Radar (GPR) involves specialized radar equipment whereby a signal is sent into the ground via a transmitter. Some portion of the signal will be reflected from the subsurface material, which is then recorded with a receiver and electronically converted into a graphic picture. In general, an object which is harder than the surrounding soil will reflect a stronger signal. Utilities, tunnels, UST's, and footings will reflect a stronger signal than the surrounding soil. Although this surface detection method may determine the location of a utility, this method does not specifically identify utilities (i.e., water vs. gas, electrical vs. telephone); hence, verification may be necessary using other methods. This method is somewhat limited when used in areas with clay soil types or with a high water table.

6.2 Passive Detection Surveys

Acoustic Surveys

Acoustic location methods are generally most applicable to waterlines or gas lines. A highly sensitive Acoustic Receiver listens for background sounds of water flowing (at joints, leaks, etc.) or to sounds introduced into the water main using a transducer. Acoustics may also be applicable to determine the location of plastic gas lines.

Thermal Imaging

Thermal (i.e., infrared) imaging is a passive method for detecting the heat emitted by an object. Electronics in the infrared camera convert subtle heat differentials into a visual image on the viewfinder or a monitor. The operator does not look for an exact temperature; rather they look for heat anomalies (either elevated or suppressed temperatures) characteristic of a potential utility line.

The thermal fingerprint of underground utilities results from differences in temperature between the atmosphere and the fluid present in a pipe or the heat generated by electrical resistance. In addition, infrared scanners may be capable of detecting differences in the compaction, temperature and moisture content of underground utility trenches. High-performance thermal imagery can detect temperature differences to hundredths of a degree.

6.3 Intrusive Detection Surveys

Vacuum Excavation

Vacuum excavation is used to physically expose utility services. The process involves removing the surface material over approximately a 1' x 1' area at the site location. The air-vacuum process proceeds with the simultaneous action of compressed air-jets to loosen soil and vacuum extraction of the resulting debris. This process ensures the integrity of the utility line during the excavation process, as no hammers, blades, or heavy mechanical equipment comes into contact with the utility line, eliminating the risk of damage to utilities. The process continues until the utility is uncovered. Vacuum excavation can be used at the proposed site location to excavate below the "utility window" which is usually 8 feet.

Hand-auger Surveys

When the identification and location of underground utilities cannot be positively confirmed through document reviews and/or other methods, borings must be hand-augered for all locations where there is a potential to impact buried utilities. The minimum hand-auger depth that must be reached is to be determined considering the geographical location of the work site. This approach recognizes that the

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 7 of 11
	Revision 1	Effective Date 03/00

placement of buried utilities is influenced by frost line depths that vary by geographical region. Attachment 2 presents frost line depths for the regions of the contiguous United States. At a minimum, hand-auger depths must be at least to the frost line depth plus two (2) feet, but never less than 4 feet below ground surface (bgs). For augering, the hole must be reamed by hand to at least the diameter of the drill rig auger or bit prior to drilling. For soil gas surveys, the survey probe shall be placed as close as possible to the cleared hand-auger. It is important to note that a post-hole digger must not be used in place of a hand-auger.

Tile Probe Surveys

For some soil types, site conditions, and excavation requirements, tile probes may be used instead of or in addition to hand-augers. Tile probes must be performed to the same depth requirements as hand-augers. Depending upon the site conditions and intended probe usage, tile probes should be made of non-conductive material such as fiberglass.

7.0 INTRUSIVE ACTIVITIES SUMMARY

The following list summarizes the activities that must be performed prior to beginning subsurface activities:

1. Map and mark all subsurface locations and excavation boundaries using white paint or markers specified by the client or property owner.
2. Notify the property owner and/or client that the locations are marked. At this point, drawings of locations or excavation boundaries shall be provided to the property owner and/or client so they may initiate (if applicable) utility clearance.

Note: Drawings with confirmed locations should be provided to the property owner and/or client as soon as possible to reduce potential time delays.

3. Notify "One Call" service. If possible, arrange for an appointment to show the One Call representative the subsurface locations or excavation boundaries in person. This will provide a better location designation to the utilities they represent. You should have additional drawings should you need to provide plot plans to the One Call service.
4. Complete Attachment 3, Utility Clearance Form. This form should be completed for each excavation location. In situations where multiple subsurface locations exist within the close proximity of one another, one form may be used for multiple locations provided those locations are noted on the Utility Clearance Form. Upon completion, the Utility Clearance Form and revised/annotated utility location map becomes part of the project file.

8.0 REFERENCES

TtNUS Utility Locating and Clearance Policy
TtNUS SOP GH-3.1; Resistivity and Electromagnetic Induction
TtNUS SOP GH-3.2; Magnetic and Metal Detection Surveys
TtNUS SOP GH-3.4; Ground-penetrating Radar Surveys

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 8 of 11
	Revision 1	Effective Date 03/00

**ATTACHMENT 1
LISTING OF UNDERGROUND UTILITY CLEARANCE RESOURCES**

ALABAMA Alabama Line Location (800) 292-8525 Tucson Blue Stake Center (800) 782-5348	Maine Dig Safe – Maine (800) 225-4977
Alaska Locate Call Center of Alaska Inc. (800) 478-3121	Maryland Miss Utility (800) 257-777 Miss Utility of Delmarva (800) 282-8555
Arizona Arizona Blue Stake Inc. (800) 782-5348	Massachusetts Dig Safe – Massachusetts (800) 322-4844
Arkansas Arkansas One Call System Inc. (800) 482-8998	Michigan Miss Dig System (800) 482-7171
California Underground Service Alert North (800) 227-2600 Underground Service Alert South (800) 227-2600	Minnesota Gopher State One Call (800) 252-1166
Colorado Utility Notification Center of Colorado (800) 922-1987	Mississippi Mississippi One-Call System Inc. (800) 227-6477
Connecticut Call Before You Dig (800) 922-4455	Missouri Missouri One Call System Inc. (800) 344-7483
Delaware Miss Utility of Delmarva (800) 282-8555	Montana Utilities Underground Location Center (800) 424-5555 Montana One Call Center (800) 551-8344
District of Columbia Miss Utility (800) 257-7777	Nebraska Diggers Hotline of Nebraska (800) 331-5666
Florida Call Sunshine (800) 432-4770	Nevada Underground Service Alert North (800) 227-2600
Georgia Utilities Protection Center Inc. (800) 282-7411	New Hampshire Dig Safe – New Hampshire (800) 225-4977
Idaho Palouse Empire Underground Coordinating Council (800) 882-1974 Utilities Underground Location Center (800) 424-5555 Kootenai Country Utility Coordinating Council (800) 428-4950 Shoshone County One Call (800) 398-3285 Dig Line (800) 342-1585 One Call Concepts (800) 626-4950	New Jersey New Jersey One Call (800) 272-1000
Illinois Julie Inc. (800) 892-0123 Digger (Chicago Utility Alert Network) (312) 744-7000	New Mexico New Mexico One Call System Inc. (800) 321-ALERT Las Cruces-Dona Utility Council (505) 526-0400
Indiana Indiana Underground Plant Protection Services (800) 382-5544	New York Underground Facilities Protection Organization (800) 962-7962 New York City: Long Island One Call Center (800) 272-4480
Iowa Underground Plant Location Service Inc. (800) 292-8989	North Carolina The North Carolina One-Call Center Inc. (800) 632-4949
Kansas Kansas One-Call Center (800) 344-7233	North Dakota Utilities Underground Location Center (800) 795-0555
Kentucky Kentucky Underground Protection Inc. (800) 752-6007	Ohio Ohio Utilities Protection Service (800) 362-2764 Oil & Gas Producers Underground Protection Service (800) 925-0988
Louisiana Louisiana One Call (800) 272-3020	Oklahoma Call Okie (800) 522-6543

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 9 of 11
	Revision 1	Effective Date 03/00


Oregon Utilities Underground Location Center (800) 424-5555 Douglas Utilities Coordinating Council (503) 673-6676 Josephine Utilities Coordinating Council (503) 476-6676 Rogue Basin Utility Coordinating Council (503) 779-6676 Utilities Notification Center (800) 332-2344
Pennsylvania Pennsylvania One Call System Inc. (800) 242-1776
Rhode Island Dig Safe – Rhode Island (800) 225-4977
South Carolina Palmetto Utility Protection Service Inc. (800) 922-0983
South Dakota South Dakota One Call (800) 781-7474
Tennessee Tennessee One-Call System (800) 351-1111
Texas Texas One Call System (800) 245-4545 Texas Excavation Safety System (800) 344-8377 Lone Star Notification Center (800) 669-8344
Utah Blue Stakes Location Center (800) 662-4111
Vermont Dig Safe – Vermont (800) 225-4977
Virginia Miss Utility of Virginia (800) 552-7001 Miss Utility (800) 257-7777 Miss Utility of Delmarva (800) 441-8355
Washington Utilities Underground Location Center (800) 424-5555 Grays Harbor & Pacific County Utility Coordinating Council (206) 535-3550 Utilities County of Cowlitz County (360) 425-2506 Chelan-Douglas Utilities Coordinating Council (509) 663-6111 Upper Yakima County Underground Utilities Council (800) 553-4344 Inland Empire Utility Coordinating Council (509) 456-8000 Palouse Empire Utilities Coordinating Council (800) 822-1974 Utilities Notification Center (800) 332-2344
West Virginia Miss Utility of West Virginia Inc. (800) 245-4848
Wisconsin Diggers Hotline Inc. (800) 242-8511

Wyoming West Park Utility Coordinating Council (307) 587-4800 Call-In Dig-In Safety Council (800) 300-9811 Fremont County Utility Coordinating Council (800) 489-8023 Central Wyoming Utilities Coordinating Council (800) 759-8035 Southwest Wyoming One Call (307) 362-8888 Carbon County Utility Utility Coordinating Council (307) 324-6666 Albany County Utility Coordinating Council (307) 742-3615 Southeast Wyoming Utilities Coordinating Council (307) 638-6666 Wyoming One-Call (800) 348-1030 Utilities Underground Location Center (800) 454-5555 Converse County Utility Coordination Council (800) 562-5561

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 10 of 11
	Revision 1	Effective Date 03/00

ATTACHMENT 2

FROST LINE PENETRATION DEPTHS BY GEOGRAPHIC LOCATION

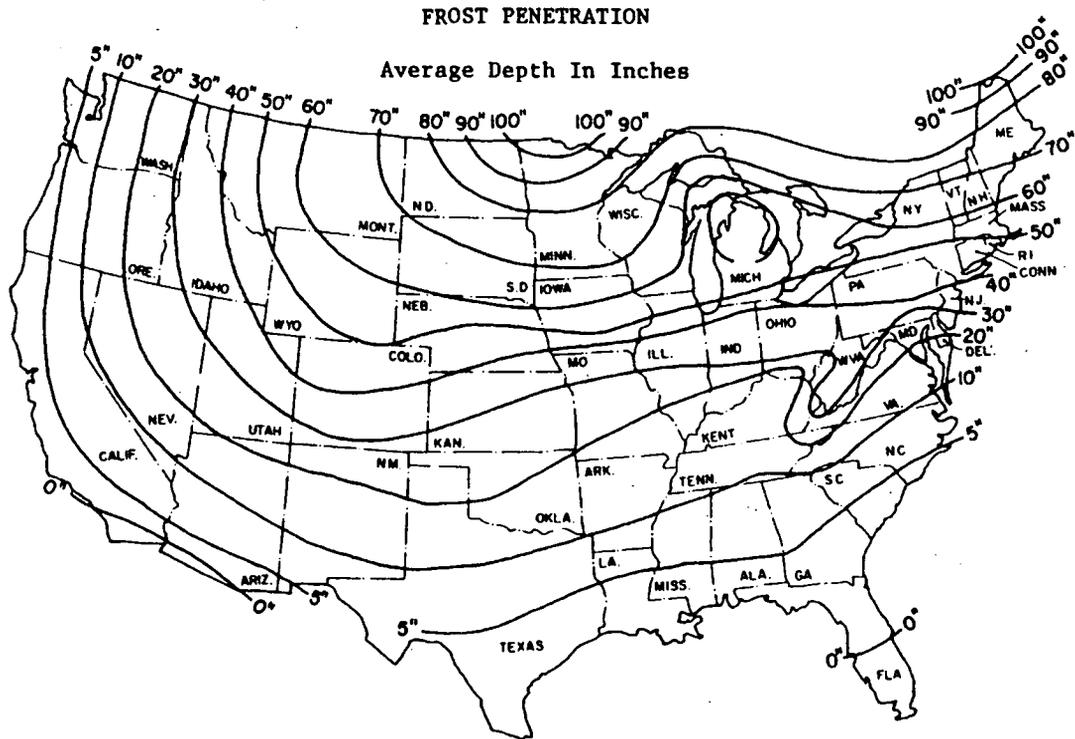

Courtesy U.S. Department Of Commerce

Subject UTILITY LOCATING AND EXCAVATION CLEARANCE	Number HS-1.0	Page 11 of 11
	Revision 1	Effective Date 03/00

**ATTACHMENT 3
UTILITY CLEARANCE FORM**

Client: _____ Project Name: _____
 Project No.: _____ Completed By: _____
 Location Name: _____ Work Date: _____
 Excavation Method/Overhead Equipment: _____

1. Underground Utilities Circle One
- a) Review of existing maps? yes no N/A
 - b) Interview local personnel? yes no N/A
 - c) Site visit and inspection? yes no N/A
 - d) Excavation areas marked in the field? yes no N/A
 - e) Utilities located in the field? yes no N/A
 - f) Located utilities marked/added to site maps? yes no N/A
 - g) Client contact notified yes no N/A
 Name _____ Telephone: _____ Date: _____
 - g) State One-Call agency called? yes no N/A
 Caller: _____
 Ticket Number: _____ Date: _____
 - h) Geophysical survey performed? yes no N/A
 Survey performed by: _____
 Method: _____ Date: _____
 - i) Hand augering performed? yes no N/A
 Augering completed by: _____
 Total depth: _____ feet Date: _____
 - j) Trench/excavation probed? yes no N/A
 Probing completed by: _____
 Depth/frequency: _____ Date: _____
2. Overhead Utilities Present Absent
- a) Determination of nominal voltage yes no N/A
 - b) Marked on site maps yes no N/A
 - c) Necessary to lockout/insulate/re-route yes no N/A
 - d) Document procedures used to lockout/insulate/re-route yes no N/A
 - e) Minimum acceptable clearance (SOP Section 5.2): _____

3. Notes:

Approval:

 Site Manager/Field Operations Leader

 Date

c: PM/Project File
 Program File

ATTACHMENT IV

EQUIPMENT INSPECTION CHECKLIST

EQUIPMENT INSPECTION

COMPANY: _____ UNIT NO. _____
 FREQUENCY: Inspect daily, document prior to use and as repairs are needed.

Inspection Date: ___/___/___ Time: _____ Equipment Type: _____

(e.g., bulldozer)
 Good Need Repair N/A

Tires or tracks	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Hoses and belts	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cab, mirrors, safety glass	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Turn signals, lights, brake lights, etc. (front/rear) for equipment approved for highway use?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Is the equipment equipped with audible back-up alarms and back-up lights?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Horn and gauges	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Brake condition (dynamic, park, etc.)	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fire extinguisher (Type/Rating - _____)	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Fluid Levels:			
- Engine oil	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Transmission fluid	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Brake fluid	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Cooling system fluid	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Windshield wipers	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Hydraulic oil	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Oil leak/lube	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Coupling devices and connectors	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Exhaust system	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Blade/boom/ripper condition	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Accessways: Frame, hand holds, ladders, walkways (non-slip surfaces), guardrails?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Power cable and/or hoist cable	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Steering (standard and emergency)	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

<u>Safety Guards:</u>		Yes	No
- Around rotating apparatus (belts, pulleys, sprockets, spindles, drums, flywheels, chains) all points of operations protected from accidental contact? _____	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Hot pipes and surfaces exposed to accidental contact? _____	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- All emergency shut offs have been identified and communicated to the field crew? _____	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Have emergency shutoffs been field tested? _____	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
- Results? _____	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

- Are any structural members bent, rusted, or otherwise show signs of damage? _____
- Are fueling cans used with this equipment approved type safety cans? _____
- Have the attachments designed for use (as per manufacturer's recommendation) with this equipment been inspected and are considered suitable for use? _____

Portable Power Tools:

- Tools and Equipment in Safe Condition? _____
- Saw blades, grinding wheels free from recognizable defects (grinding wheels have been sounded)? _____
- Portable electric tools properly grounded? _____
- Damage to electrical power cords? _____
- Blade guards in place? _____
- Components adjusted as per manufacturers recommendation? _____

Cleanliness:

- Overall condition (is the decontamination performed prior to arrival on-site considered acceptable)? _____
- Where was this equipment used prior to its arrival on site? _____
- Site Contaminants of concern at the previous site? _____
- Inside debris (coffee cups, soda cans, tools and equipment) blocking free access to foot controls? _____

Operator Qualifications (as applicable for all heavy equipment):

- Does the operator have proper licensing where applicable, (e.g., CDL)? _____
- Does the operator, understand the equipments operating instructions? _____
- Is the operator experienced with this equipment? _____
- Does the operator have emotional and/or physical limitations which would prevent him/her from performing this task in a safe manner? _____
- Is the operator 21 years of age or more? _____

Identification:

- Is a tagging system available, for positive identification, for tools removed from service? _____

Additional Inspection Required Prior to Use On-Site

- | | Yes | No |
|---|--------------------------|--------------------------|
| - Does equipment emit noise levels above 90 decibels? | <input type="checkbox"/> | <input type="checkbox"/> |
| - If so, has an 8-hour noise dosimetry test been performed? | <input type="checkbox"/> | <input type="checkbox"/> |
| - Results of noise dosimetry: _____ | | |
| - Defects and repairs needed: _____ | | |
| - General Safety Condition: _____ | | |
| - Operator or mechanic signature: _____ | | |

Approved for Use: Yes No

Site Safety Officer Signature

ATTACHMENT V
SAFE WORK PERMITS

**SAFE WORK PERMIT
SOIL BORING OPERATIONS
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Soil boring using direct push technology hollow stem auger, or hand auger.
- II. Required Monitoring Instrument(s): FID or PID with at least a 10.6 eV lamp
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TINUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- V. Protective equipment required
 - Level D Level B
 - Level C Level A
 - Detailed on Reverse
- Respiratory equipment required
 - Full face APR
 - Half face APR
 - PAPR
 - Skid Rig
- Escape Pack
- SCBA
- Bottle Trailer
- None

Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants, safety footwear, and nitrile gloves

- VI. Chemicals of Concern VOC's, SVOC's, Metals, and components of energetics
 - Action Level(s) Any sustained readings above background in worker breathing zone
 - Response Measures Suspend site activities report to an unaffected area.

- VII. Additional Safety Equipment/Procedures

Hard-hat <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Safety Glasses <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Chemical/splash goggles <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Splash Shield <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Splash suits/coveralls <input type="checkbox"/> Yes <input type="checkbox"/> No Steel toe Work shoes or boots <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Hearing Protection (Plugs/Muffs) <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Safety belt/harness <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Radio <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Barricades <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Gloves (Type - Nitrile) <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Work/rest regimen <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
--	--

Modifications/Exceptions: Tyvek coverall if there is a potential for soiling work cloths and PVC or PE coated Tyvek if saturation or work cloths may occur. Hard hats and hearing protection if sampling near the DPT vehicle.

- VIII. Procedure review with permit acceptors

Safety shower/eyewash (Location & Use) <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Procedure for safe job completion <input type="checkbox"/> Yes <input checked="" type="checkbox"/> NA Contractor tools/equipment/PPE inspected <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA	Emergency alarms <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Evacuation routes <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Assembly points <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA
---	--

- IX. Site Preparation

Utility Locating and Excavation Clearance completed <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Vehicle and Foot Traffic Routes Cleared and Established <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Physical Hazards Barricaded and Isolated <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA Emergency Equipment Staged <input checked="" type="checkbox"/> Yes <input type="checkbox"/> NA	
--	--

- X. Additional Permits required (Hot work, confined space entry, excavation etc.) Yes No
 If yes, complete permit required or contact Health Sciences, Pittsburgh Office

- XI. Special instructions, precautions Suspicious materials or items shall be avoided and reported to the site contact.

Permit Issued by: _____ Permit Accepted by: _____

**SAFE WORK PERMIT
DECONTAMINATION ACTIVITIES
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Decontamination of sampling equipment. Brushes and spray bottles will be used to decon small sampling equipment
- II. Required Monitoring Instrument(s): None required
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TINUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- | | | |
|--|--|--|
| IV. Protective equipment required | Respiratory equipment required | |
| Level D <input checked="" type="checkbox"/> Level B <input type="checkbox"/> | Full face APR <input type="checkbox"/> | Escape Pack <input type="checkbox"/> |
| Level C <input type="checkbox"/> Level A <input type="checkbox"/> | Half face APR <input type="checkbox"/> | SCBA <input type="checkbox"/> |
| Detailed on Reverse | PAPR <input type="checkbox"/> | Bottle Trailer <input type="checkbox"/> |
| | Skid Rig <input type="checkbox"/> | None <input checked="" type="checkbox"/> |

Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants, safety glasses, safety footwear, and nitrile gloves..

- | | | |
|--|-----------------|-------------------|
| V. Chemicals of Concern | Action Level(s) | Response Measures |
| <u>None anticipated given the nature of surveying activities and limited contact w/ media.</u> | _____ | _____ |

- | | |
|--|--|
| VI. Additional Safety Equipment/Procedures | |
| Hard-hat <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Hearing Protection (Plugs/Muffs).... <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Safety Glasses <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Safety belt/harness <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Chemical/splash goggles <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Radio <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash Shield <input type="checkbox"/> Yes <input type="checkbox"/> No | Barricades..... <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash suits/coveralls..... <input type="checkbox"/> Yes <input type="checkbox"/> No | Gloves (Type - Nitrile)..... <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No |
| Steel toe Work shoes or boots..... <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Work/rest regimen <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |

Modifications/Exceptions: PVC rain suits or PE or PVC coated Tyvek for protection against splashes and overspray. Chemical resistant boot covers if excessive liquids are generated or to protected footwear. Splash shield and hearing protection when using high pressure wash and rinse.

- | | | | | |
|--|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| VII. Procedure review with permit acceptors | Yes | NA | Yes | NA |
| Safety shower/eyewash (Location & Use)..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Procedure for safe job completion | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Contractor tools/equipment/PPE inspected | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

- | | | |
|---|--------------------------|-------------------------------------|
| VIII. Site Preparation | Yes | NA |
| Utility Locating and Excavation Clearance completed | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| Vehicle and Foot Traffic Routes Cleared and Established | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| Physical Hazards Barricaded and Isolated | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| Emergency Equipment Staged | <input type="checkbox"/> | <input checked="" type="checkbox"/> |

- IX. Additional Permits required (Hot work, confined space entry, excavation etc.) Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

- X. Special instructions, precautions: Chemical hazards with decontamination because of use of fluids such as isopropyl alcohol, methanol, etc. To minimize the potential for exposure, site personnel will use PPE and prevent contact with potentially contaminated equipment. Refer to the manufacturer's MSDS regarding PPE, handling, storage, and first-aid measures related to decontamination fluids.

Permit Issued by: _____ Permit Accepted by: _____

**SAFE WORK PERMIT
INVESTAGIVE DERIVED WASTE (IDW) ACTIVITIES
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Handling, sampling and staging of IDW drums.
- II. Required Monitoring Instruments: FID or PID with 10.6eV (or higher) lamp
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TINUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- IV. Protective equipment required Respiratory equipment required
- | | | | |
|---|----------------------------------|--|--|
| Level D <input checked="" type="checkbox"/> | Level B <input type="checkbox"/> | Full face APR <input type="checkbox"/> | Escape Pack <input type="checkbox"/> |
| Level C <input type="checkbox"/> | Level A <input type="checkbox"/> | Half face APR <input type="checkbox"/> | Airline/SCBA <input type="checkbox"/> |
| Detailed on Reverse | | PAPR <input type="checkbox"/> | Bottle trailer <input type="checkbox"/> |
| | | Skid Rig <input type="checkbox"/> | None <input checked="" type="checkbox"/> |
- Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants, safety shoes, hardhat, nitrile outer gloves with surgical-style inner gloves, impermeable boot covers.

- | | | |
|--|---|--|
| VI. Chemicals of Concern | Action Level(s) | Response Measures |
| <u>VOC's, SVOC's, Metals, and components of energetics</u> | <u>Any sustained readings above background in worker breathing zone</u> | <u>Suspend site activities report to an unaffected area.</u> |

- VI. Additional Safety Equipment/Procedures
- | | | | |
|-------------------------------------|---|---------------------------------------|---|
| Hard-hat | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Hearing Protection (Plugs/Muffs)..... | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Safety Glasses | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Safety belt/harness | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Chemical/splash goggles..... | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Radio | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash Shield | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Barricades | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash suits/coveralls | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Gloves (Type - Nitrile)..... | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No |
| Steel toe Work shoes or boots | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Work/rest regimen..... | <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No |
- Modifications/Exceptions: Tyvek coverall if there is a potential for soiling clothes. Work/rest regimen to be determined by SSO & site personnel

- | | | | | |
|---|-------------------------------------|--------------------------|-------------------------|--|
| VII. Procedure review with permit acceptors | Yes | NA | Yes | NA |
| Safety shower/eyewash (Location & Use)..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | Emergency alarms | <input checked="" type="checkbox"/> <input type="checkbox"/> |
| Procedure for safe job completion..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | Evacuation routes | <input checked="" type="checkbox"/> <input type="checkbox"/> |
| Contractor tools/equipment/PPE inspected..... | <input type="checkbox"/> | <input type="checkbox"/> | Assembly points | <input checked="" type="checkbox"/> <input type="checkbox"/> |

- | | | | |
|---|-------------------------------------|--------------------------|-------------------------------------|
| IX. Site Preparation | Yes | No | NA |
| Utility Locating and Excavation Clearance completed..... | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| Vehicle and Foot Traffic Routes Cleared and Established | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| Physical Hazards Barricaded and Isolated..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| Emergency Equipment Staged..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

- IX. Additional Permits required (Hot work, confined space entry, excavation etc.)..... Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

X. Special instructions, precautions: _____

Permit Issued by: _____ Permit Accepted by: _____

**SAFE WORK PERMIT FOR
MOBILIZATION AND DEMOBILIZATION ACTIVITIES
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Mobilization and demobilization activities
- II. Required Monitoring Instruments: None
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TINUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- V. Protective equipment required
 - Level D Level B
 - Level C Level A
 - Detailed on Reverse
 - Respiratory equipment required
 - Full face APR
 - Half face APR
 - PAPR
 - Skid Rig
 - Escape Pack
 - SCBA
 - Bottle Trailer
 - None
- Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants, safety glasses and safety footwear. Hard hats and hearing protection will be worn when working near operating equipment.

VI. Chemicals of Concern	Action Level(s)	Response Measures
None anticipated given the nature of these activities and limited contact w/ media.		

- VII. Additional Safety Equipment/Procedures

Hard-hat <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Hearing Protection (Plugs/Muffs) ... <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Safety Glasses <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Safety belt/harness <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Chemical/splash goggles <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Radio <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Splash Shield <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Barricades..... <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Splash suits/coveralls..... <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Gloves (Type - Nitrile) <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Steel toe Work shoes or boots..... <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Work/rest regimen <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

Modifications/Exceptions: Reflective vests for high traffic areas. Tyvek coverall to protect against natural hazards (e.g., ticks). If working in areas where snakes are a threat, wear snake chaps to protect against bites.

VIII. Procedure review with permit acceptors	Yes	NA	Yes	NA
Safety shower/eyewash (Location & Use).....	<input type="checkbox"/>	<input type="checkbox"/>	Emergency alarms.....	<input type="checkbox"/>
Procedure for safe job completion.....	<input type="checkbox"/>	<input type="checkbox"/>	Evacuation routes.....	<input type="checkbox"/>
Contractor tools/equipment/PPE inspected.....	<input type="checkbox"/>	<input type="checkbox"/>	Assembly points.....	<input type="checkbox"/>

- IX. Site Preparation

Utility Locating and Excavation Clearance completed.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Vehicle and Foot Traffic Routes Cleared and Established.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Physical Hazards Barricaded and Isolated.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Emergency Equipment Staged.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>

- X. Additional Permits required (Hot work, confined space entry, excavation etc.). Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

- XI. Special instructions, precautions: Preview work locations to identify potential hazards (slips, trips, and falls, natural hazards, etc.) Avoid potential nesting areas. Wear light colored clothing so that ticks and other biting insects can be easily visible and can be removed. Inspect clothing and body for ticks. Minimize contact with potentially contaminated media. Suspend site activities in the event of inclement weather.

Permit Issued by: _____ Permit Accepted by: _____

**SAFE WORK PERMIT FOR
MULTI MEDIA SAMPLING
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Multi media sampling including Surface and Subsurface Soils
- II. Required Monitoring Instrument(s): FID or a PID with at least a 10.6 eV lamp
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TtNUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- | | | |
|--|--|--|
| V. Protective equipment required | Respiratory equipment required | |
| Level D <input checked="" type="checkbox"/> Level B <input type="checkbox"/> | Full face APR <input type="checkbox"/> | Escape Pack <input type="checkbox"/> |
| Level C <input type="checkbox"/> Level A <input type="checkbox"/> | Half face APR <input type="checkbox"/> | SCBA <input type="checkbox"/> |
| Detailed on Reverse | PAPR <input type="checkbox"/> | Bottle Trailer <input type="checkbox"/> |
| | Skid Rig <input type="checkbox"/> | None <input checked="" type="checkbox"/> |

Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants, safety footwear, and nitrile gloves

- | | | |
|--|---|--|
| VI. Chemicals of Concern | Action Level(s) | Response Measures |
| <u>VOC's, SVOC's, Metals, and components of energetics</u> | <u>Any sustained readings above background in worker breathing zone</u> | <u>Suspend site activities report to an unaffected area.</u> |

- VII. Additional Safety Equipment/Procedures
- | | |
|---|--|
| Hard-hat <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Hearing Protection (Plugs/Muffs) <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Safety Glasses <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Safety belt/harness <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Chemical/splash goggles <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Radio <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash Shield <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Barricades <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash suits/coveralls <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Gloves (Type - Nitrile) <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No |
| Steel toe Work shoes or boots <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Work/rest regimen <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |

Modifications/Exceptions: Tyvek coverall if there is a potential for soiling work cloths and PVC or PE coated Tyvek if saturation or work cloths may occur.

- | | | | | |
|--|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| VIII. Procedure review with permit acceptors | Yes | NA | Yes | NA |
| Safety shower/eyewash (Location & Use)..... | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Procedure for safe job completion | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Contractor tools/equipment/PPE inspected | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

- IX. Site Preparation
- | | | |
|---|-------------------------------------|--------------------------|
| Utility Locating and Excavation Clearance completed | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Vehicle and Foot Traffic Routes Cleared and Established | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Physical Hazards Barricaded and Isolated | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| Emergency Equipment Staged | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

- X. Additional Permits required (Hot work, confined space entry, excavation etc.). Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

- XI. Special instructions, precautions Suspicious materials or items shall be avoided and reported to the site contact.

Permit Issued by: _____ Permit Accepted by: _____

**SAFE WORK PERMIT FOR
GEOGRAPHICAL AND GEOPHYSICAL SURVEYING
NSWC, CRANE INDIANA**

Permit No. _____ Date: _____ Time: From _____ to _____

SECTION I: General Job Scope

- I. Work limited to the following (description, area, equipment used): Geographical and Geophysical activities
- II. Required Monitoring Instruments: None
- III. Field Crew: _____
- IV. On-site Inspection conducted Yes No Initials of Inspector TINUS

SECTION II: General Safety Requirements (To be filled in by permit issuer)

- V. Protective equipment required
 - Level D Level B
 - Level C Level A
 - Detailed on Reverse
- Respiratory equipment required
 - Full face APR
 - Half face APR
 - PAPR
 - Skid Rig
- Escape Pack
- SCBA
- Bottle Trailer
- None

Modifications/Exceptions: Minimum requirement include sleeved shirt and long pants. Steel toe safety footwear is not required for geophysical survey.

VI. Chemicals of Concern	Action Level(s)	Response Measures
None anticipated given the nature of surveying activities and limited contact w/ media.		

VII. Additional Safety Equipment/Procedures

- | | |
|---|---|
| Hard-hat <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Hearing Protection (Plugs/Muffs) .. <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Safety Glasses <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Safety belt/harness <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Chemical/splash goggles <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Radio <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash Shield <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Barricades <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Splash suits/coveralls <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | Gloves (Type - Nitrile) <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Steel toe Work shoes or boots <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No | Work/rest regimen <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |

Modifications/Exceptions: Reflective vests for high traffic areas. Tyvek coverall to protect against natural hazards (e.g., ticks). If working in areas where snakes are a threat, wear snake chaps to protect against bites.

VIII. Procedure review with permit acceptors	Yes	NA	Yes	NA
Safety shower/eyewash (Location & Use).....	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Emergency alarms..... <input checked="" type="checkbox"/>	<input type="checkbox"/>
Procedure for safe job completion.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Evacuation routes..... <input checked="" type="checkbox"/>	<input type="checkbox"/>
Contractor tools/equipment/PPE inspected.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Assembly points <input checked="" type="checkbox"/>	<input type="checkbox"/>

IX. Site Preparation	Yes	NA
Utility Locating and Excavation Clearance completed	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Vehicle and Foot Traffic Routes Cleared and Established.....	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Physical Hazards Barricaded and Isolated	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Emergency Equipment Staged	<input checked="" type="checkbox"/>	<input type="checkbox"/>

- X. Additional Permits required (Hot work, confined space entry, excavation etc.). Yes No
If yes, complete permit required or contact Health Sciences, Pittsburgh Office

XI. Special instructions, precautions: Preview work locations to identify potential hazards (slips, trips, and falls, natural hazards, etc.) Avoid potential nesting areas. Wear light colored clothing so that ticks and other biting insects can be easily visible and can be removed. Inspect clothing and body for ticks. Minimize contact with potentially contaminated media. Suspend site activities in the event of inclement weather.

Permit Issued by: _____ Permit Accepted by: _____